







Basic information

Basic Structure Main Units Machine Performance CUFOS

Detailed Information

Options
Diagrams
Specifications

Customer Support Service



PUMA SMX series

PUMA SMX series, Doosan's next generation Multi-tasking Turning Center, features high productivity, high precision and easy operation. By integrating the capabilities of multiple machines into one system, the PUMA SMX series provides best in class machining capability by using multi-tasking functions which minimize the machining time and the number of machining operations. The PUMA SMX series also provides excellent performance for high precision machining by minimizing thermal deformation and applying an accuracy control feature based on multiple thermal compensation functions. Ergonomic design considering operator convenience and efficient maintenance provides an optimal solution that meets the customer's needs.

Contents

02 **Product Overview**

Basic information

- 04 Basic structure and cooling Concept
- 05 Main Units
- Machine Performance 10
- 16 **CUFOS**

Detailed Information

- 21 Standard / Optional Specifications
- 24 Diagrams
- Machine / CNC Specifications



* This image contains several options.

Higher Productivity through Powerful Multi-tasking Functions

Decreases the total processing time and number of machining operations by using a single setup. This provides excellent high speed performance for component manufacturing processes which require accurate and complex machining.

- Complex machining capabilities of left spindle, right spindle, B-axis, milling spindle and lower turret
- High-rigidity machine construction using structural analysis design
- Maximized Y-axis machining area through orthogonal design structure
- Maximize productivity through simultaneous machining

Enhanced Precision through High Accuracy Control Functions

Maintains excellent precision during long-term machining processes by minimizing the thermal deformation of the spindle and the feed axis, and maximises precision through the 0.0001° axis resolution control function.

- Minimized thermal deformation of the spindle and feed axis using oil cooler
- Adoption of Roller LM Guideways with high-rigidity and high precision
- Equipped with 0.0001° B-axis and C-axis accuracy control function

Easy and Convenient Operation through an Ergonomic Design

Features excellent maintenance as well as usability and convenience through customized functions.

- Front located tool magazine
- Side-to-side movable swiveling operation panel with adjustable height
- Convenient ATC MAGAZINE operation panel

Basic information

Basic Structure Main Units

Machine Performance CUFOS

Detailed Information

Options
Diagrams
Specifications

Customer Support Service

Basic Structure

Highly Rigid Design. All units are located on the main frame vertically for high rigidity.


Robust Design

FEM (Finite Element Method) analysis results in superior machine stability. All guideways are sealed with a protective covers, preventing high temperature chips and coolant from contacting the guideways, thus maintaining unsurpassed long-term accuracy.




Feed Axis

Extended axis travel distance and improved rapid traverse rate improve workpiece machining and provide excellent productivity. The X, Y and Z-axis move orthogonally to reflect high precision machine accuracy into machining accuracy.

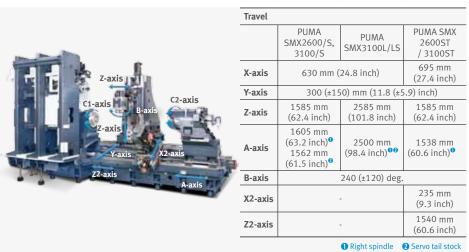

High Precision Roller type LM Guideways

SP class roller type LM guideways for extra load capacity and rigidity are used on all axes to enable high rapid traverse rates.

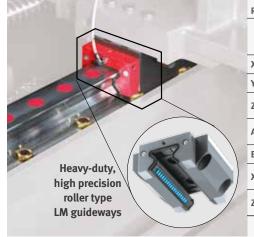

Rapid tra	averse rate							
	PUMA SMX2600/S, 3100/S	PUMA SMX2600ST / 3100ST	PUMA SMX3100L/LS					
X-axis	48 n	n/min (1889.8 ip	om)					
Y-axis	36 n	n/min (1417.3 ip	om)					
Z-axis	48 m/min (1	48 m/min (1889.8 ipm)						
A-axis	30 m (1181,1		20 m/min (787.4 ipm)					
B-axis		40 r/min						
X2-axis	-	24 m/min (944.9 ipm)	-					
Z2-axis	-	36 m/min (1417.3 ipm)	-					
	Pight enin	ıdla (Sanıo tail stocl	vis not applicable)					




Basic Cooling Concept for Higher Accuracy in a Long time Machining

Structural preparation to minimize thermal error and ensure superior accuracy for a long time operation


Minimization of Thermal Deformation by Oil Cooling

Spindle and ball screw core cooling system minimizes thermal deformation during long machining processes and enhances high accuracy performance.

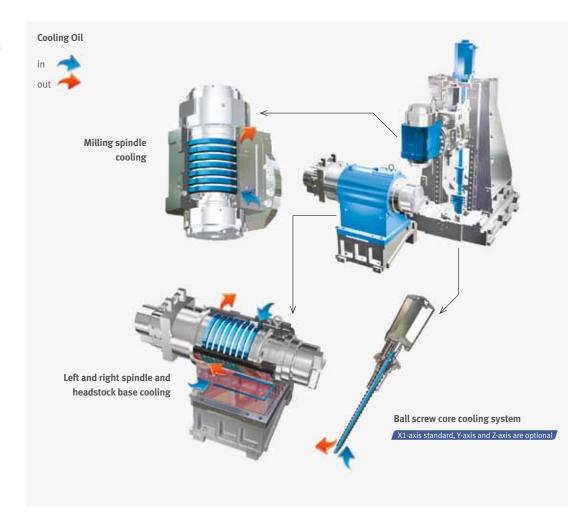


Cutting Accuracy

By performing extended test procedures of individual machine elements and detailed analysis of results, the SMX series achieves a high level of precision and reliability that fulfills customer satisfaction.

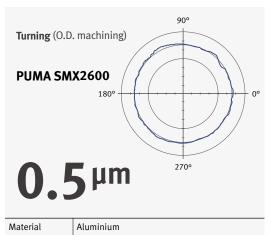

Material	Aluminium
Tool	Diamond tool (Nose radius 0.5 min (0.02 in.))
Spindle speed	3000 r/min
Feedrate	0.5 mm/rev (0.02 ipr)

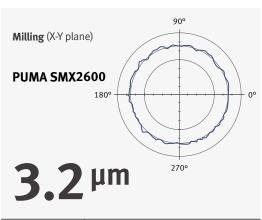

Material	Aluminium
Tool	End mill Ø20 mm (0.787 in.)
Spindle speed	8000 r/min
Feedrate	2500 mm/min (98.4 ipm)



Perfect combination of

3 key spindles to

ensure machining

stability under various cutting conditions.

Basic information

Basic Structure Main Units Machine

Machine Performance CUFOS

Detailed Information

Options
Diagrams
Specifications

Customer Support Service

Perfect combination of key-rotation axis

Both left and right spindle are capable of high accuracy C-axis control and perform various machining functions like turning, milling and synchronized cutting using single set-up with milling spindle.









Model	Spindle	Standard Chuck (inch)	Spindle speed (r/min)	Power kW (Hp)	Torque N·m (ft-lbs)	Condition	
PUMA SMX2600 series	Left	10	4000	26 / 22 (34.9 / 29.5)	700 (516.6)*	30min/cont.	
PUMA SMX3100 series	Spindle	12	3000	30 / 25 (40.2 / 33.5)	1203 (887.8)	30min/cont.	
PUMA SMX2600S/3100S/ 3100LS	Right	10	4000	26 / 22	700 (516.6)*	20min/cont	
PUMA SMX2600ST/ 3100ST	Spindle	10	4000	(34.9 / 29.5)	621 (458.3)*	30min/cont.	

* On S3 25% operation

Model	Spindle	Tool shank	Spindle speed (r/min)	Power kW (Hp)	Torque N·m (ft-lbs)	Condition	
PUMA SMX2600 series	Milling	CAPTO C6	12000	26 / 18.5 / 15	124 (91.5)*	2.5min /	
PUMA SMX3100 series	Spindle	CAPIO CO	12000	(34.9 / 24.8 / 20.1)	124 (91.5)	10min / cont.	

High Precision Control of Spindle axes (C & B-axis)

Machining operation is mainly done by Left and Milling spindle. C-axis of left spindle and B-axis of milling spindle with Y-axis control realize multi-tasking turning center that can drill, tap and end mill in any angle and also deliver the ability to cut precise angles and sculpted contours(5-axis simultaneous controlled specification is option).






More easier and faster set-up of the tailstock using M-code program by servo motor and ball screw

Servo driven tailstock

Servo tailstock make part set-up faster and easier. The operator inputs the proper M-code information in the control and tailstocks move to its proper positions automatically by linear motion control of servo motor and ball screw. No manual adjustments are required.

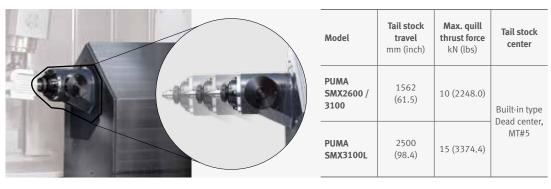

Basic information

Basic Structure Main Units Machine

Performance CUFOS

Detailed Information

Options
Diagrams
Specifications


Customer Support Service

ATC Automatic Tool Changer

Servo ATC and Servo tool magazine ensuring fast and reliable tool indexing

Servo driven ATC & Tool magazine

The tool magazine can be increased up to 120 tools and tools are selected by a fixed address method that follows the shorter path.

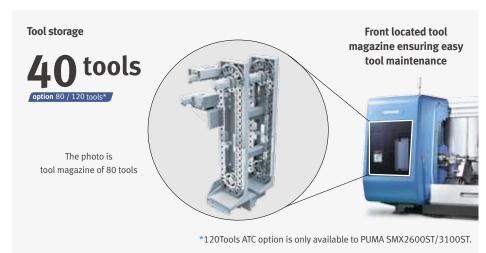

Max. tool length (from gauge line)	450 mm (17.7 inch)				
Max. tool weight	12 kg (26.5 lb)				
Max. tool moment	9.8 N·m (7.2 ft-lbs)				
Max. tool diameter (continuous)	90 mm (3.5 inch)				
Max. tool diameter (adjacent pots are empty)	130 mm (5.1inch)				

ATC-MAGAZINE Operation Panel

Displays ATC - MAGAZINE related

information and supports manual

operation by touchscreen. 7.5-

operation panel.

inch large screen specification is available for the ATC – MAGAZINE

The status of ATC and the tool magazine unit are identified visually by using a graphic touch panel display and touch operation. The touch screen also operates the ATC, the tool magazine and the tool feed pot carrier individually.



The internal operation status of the

camera and displayed on the screen .

ATC can be photographed by the

Improves the tool management by saving and displaying useful tool

related information.



As option just for PUMA SMX3100L/LS, long boring bar magazine is available to ensure more easy application to long tube machining

- 1) You can select tools storage capacity 2+1 tools instead of 3 tools. The 2+1 tools storage means 2 tools of Ø60 x L600 mm or Ø30 x L800 mm and 1 large diameter tools, Ø190 x L200 mm can be mounted in long boring bar magazine.
- Ø30 x L800 mm sized tool is not Long boring bar but Gun drill. We do not recommend long boring bar sized Ø30 x L800 mm.

Tools magazine for Long boring bar option for PUMA SMX3100L / LS

PUMA SMX3100L/LS can be equipped with long boring bar magazine as option.

Tool storage

3 tools 1



PUMA SMX3100L/LS can accommodate workpieces as long as 2540mm between centers. The machine can process long tube such as landing gear axle requiring the center bore. Because the Automatic tool changer on this model cannot handle long boring bar, the separate tool magazine just for these tools can has 3 tool stations for tools as long as max. 600mm

Max. Tool size

Max. Weight

Ø 60 x L 600 mm

15kg

(Ø 2.4 x L 23.6 inch)

(33.1 lb)

Max. Tool size

Max. Weight

Ø30 x L800 mm²

15kg

(Ø 2.4 x L 31.5 inch)

(33.1 lb)



Turret

Strong and rigid lower turret in multi-tasking is to provide more powerful manufacturing performance and a variety of new applications.

High rigid servo driven Lower turret (only on PUMA SMX2600ST / 3100ST)

Turret rotation, acceleration/deceleration and large diameter curvic coupling are controlled by a high-torque servo motor. Unclamp and rotation are virtually simultaneous. The fast index response keeps cycle times short.

Number of Tool stations

12 ea

Tool holder type

BMT 65P

Max. Rotary Tool Speed

5000 r/min



Various applications of lower turret





Basic information

Basic Structure Main Units Machine Performance CUFOS

Detailed Information

Options
Diagrams
Specifications

Customer Support Service

Machining Area

Expands machining capacity using an orthogonal structure and enables machining of large size workpieces through the extended turning diameter.


Maximized Y-axis Mmachining Area Using Orthogonal Structure Design

Maximized Y-axis machining area because of orthogonal structure design allows the machining of a wide range of workpieces.



Extended Machining Area

The extended machining area allows machining of large diameter and long workpieces.

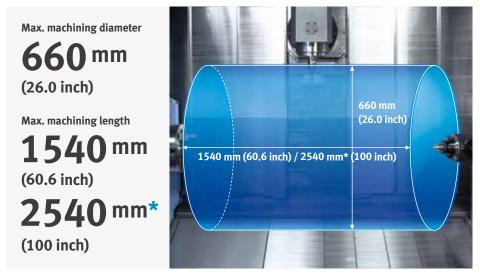

* PUMA SMX3100L/LS

Large Bar Working Diameter

Both SMX2600 and 3100 models provide large bar diameter capacity through the spindle drawtube.





Powerful machining capability in various operation such as turning, milling and drill and tapping and multitasking performance ensuring more higher machining efficiency.

Powerful Machining

O.D. cutti	ng (PUMA SM)	(3100)					
		ig speed in (ipm)	Feedrate mm/rev (ipr)	Radial cutting depth mm (inch)		h	Material removal rate cm³/min (inch³/min)
253	I	210 (67.7)	0.55 (0.022)	8.5 (0.3)			1405 (85.7)
U-drill (mi	lling)						
	Tool (inch)	Milling	spindle speed r/min	1	F eedrate 1/min (ipm)	Material removal rate cm³/min (inch³/min)
Ø6:	3 (2.5)		1010	1	31 (5.2)		409 (25.0)
Face milli	ng						
Tool mm (inch)	Milling spi r/n		Radial cutti mm (ii		Feedr mm/min		Material removal rate cm³/min (inch³/min)
Ø80 (3.1)	11	00	5 (0.	5 (0.2)		44.0)	357 (21.8)
End millin	g						
Tool mm (inch)	Milling spi r/n			Radial cutting depth mm (inch)		ate (ipm)	Material removal rate cm³/min (inch³/min)
Ø25 (1.0)	38	32	25 (1	25 (1.0)		7.9)	125 (7.6)
Tapping							
Tool mm (inch)				indle spee 'min	d		Feedrate mm/min (ipm)
M30 x	P3.5 (M1.2 x	P0.1)		212			742 (29.2)

^{*} The results, indicated in this catalogue are provides as example. They may not be obtained due to differences in cutting conditions and environmental conditions during measurement.

Higher Productivity by Multi-tasking performance

Faster machining time compared to many conventional machines provides superior productivity and machining capability.







Basic information

Basic Structure Main Units Machine Performance CUFOS

Detailed Information

Options
Diagrams
Specifications


Customer Support Service

Application Performance

Multitasking, which is performing more than one duty at once, This can lead to as much as a 40 percent increase in productivity and can positively impact your company's bottom line.

Benefits of Multi-tasking operation

Using a single set up, one machine is capable of performing all machining processes that generally require two three or even more machines. By minimizing time and labor, the process cost is reduced and lead times are shortened by up to 75%. This provides a significant advantage when manufacturing small batches of a variety of products.

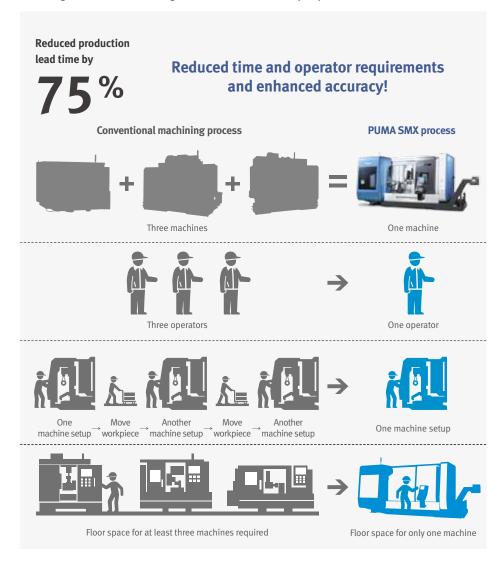


Providing 5-axis Complex Machining Capabilities (Standard when applying FANUC 31i-5)

Simultaneous 5-axis machining functions such as TCP* are built-in, thereby making the machining of complex shapes easier, such as an automotive engine impeller or an aero engine blade.

Tool Center Point Control

- Facilitating the high precision machining of the surface by automatic control of tool path
- Decreasing the time for the machining setup and the cutting process

Real tool move

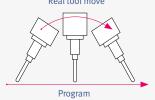

Cutting point command option


- Increasing the productivity by automatically compensating when using various tool tips without changing the machining program
- Performing effective tool correction

Ball-end mill Radius-end mill Square-end mill

Cutting point (programmed)

Various Application

Just single machine, PUMA SMX series can meet all machining requirements. That's why, your investing in PUMA SMX series that boost your capabilities can take your operations to the highest level of performance, including your all-important return on investment.

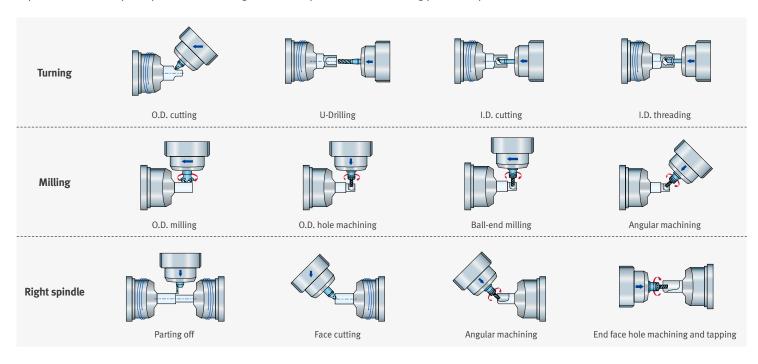

Application Sample

Optimal Applications of High Productivity

Complex machining capabilities of the PUMA SMX series enable machining over a wide range of applications in various industries, such as aerospace, energy, shipbuilding, medical, etc.

A wide range of applications based on high productivity











Drill bits

Industry I Energy □ D165 X D175 Material | Stainless steel

Tools | 15 Shaft

Industry I General | D150 X L350 Size Material | Aluminum Tools | 14

Die roller

Industry I Medical I D185 X L330 Size Material | Aluminum Tools

Valve

Industry I General D300 X L450 Size Material | Stainless steel Tools

Optimal Applications of Accuracy

Stable control technology and excellent level of accuracy enables delicate and detailed workpiece machining.

Wide range of workpieces based on high precision









Housing

Industry I General Machinery I D150 X L300 Size Material I Aluminum Tools ∣ 19

Impeller

Industry I Aerospace | D120 X L80 Material I Aluminum Tools ۱ 6

Barrel

Industry I Electronics □ D70 X L50 Size Material | Aluminum Tools 1 50

Bucket blade

Industry I Energy | 85t x D120 x L600 Material | Stainless steel Tools 18

Basic information

Basic Structure Main Units Machine Performance CUFOS

Detailed Information

Options
Diagrams
Specifications

Customer Support Service

Ergonomic Design

Maximizes user's convenience by employing ergonomic design concept

Ease of Machine Setup through Ergonomic Design

By laying out the operation panel and tool magazine in a user-friendly way, tooling and workpiece setup become easier for the operator.



Award







An excellently designed
PUMA SMX series has received the
world's leading design awards,
such as the 2014 German Red Dot,
the 2013 Australian AIDA
(Australian International Design Award),
the 2013 Korean Good Design, etc.
Thus, it is internationally
recognized for its shape,
function, quality, safety
sustainability and innovation.



3.
Easy access for the operator to the spindle through the angled style exterior front cover
Minimum distance for operator reach to reduce

Convenient ATC-MAGAZINE operation panel
Easy ATC and magazine condition check by using a touch screen

Extended front window

Enables the operator to easily monitor the machining operation using the large front window






Safety Design to decrease Collision-caused Damage

Machine Airbag Function

fatigue

Machine airbag function minimizes damage in the event of a machine collision, defect or heavy load by detecting sudden axis load increase.

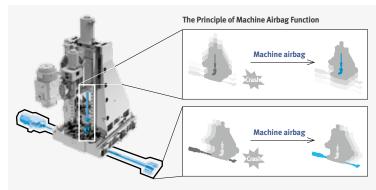

If a collision is detected by a sudden increase in torque during axis movement, the servo motor immediately moves in reverse to partially retract the cutter.



Easy Operation and Maintenance

Enhances ease of operation by the design based on the operator's functions and also provides maintenance functions that reduce downtime by decreasing the MTTR.*


User-friendly Operation Panel

The operator panel is designed to provide easy operation and also maintenance functions to reduce downtime. A large size 15-inch screen is applied as standard on the customized operator panel.



Simple Alarm Function


Doosan's EOP* system enables the user to operate the NC* system more conveniently.

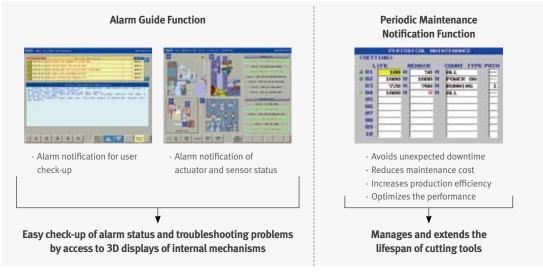

* EOP: Easy Operation Package / NC: Numerical Control

Tool Load Monitoring

It is possible to display various types of information about each tool and to monitor the tool load in real-time.

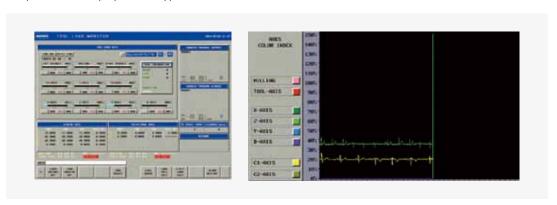

Basic information

Basic Structure Main Units Machine Performance

Detailed Information

Options
Diagrams
Specifications

Customer Support Service

CUF05

Customized User-friendly Flexible Operation Solutions

CUFOS is a PC based control system created by Doosan Machine Tools. Equipped with intuitive user-friendly functions such as a smart phone screen and easy customization, CUFOS helps to improve operational efficiency and performance for the user.

Features of CUFOS

User-Friendly

- 19 inch Multi Touch Screen
- Multiple Apps such as –
- CPS app (Collision Protection System)
- Turn-cut app
- Tool management app
- Status monitoring and alarm guidance app
- Max. program memory: 40GB option
- App-based Interface for Smartphones & Tablet PC

Customized

- Simple Customization
- Extend Functionality with Additional apps
- Register for up to 6 individual users

Flexible

- Simple Connectivity with External Software (Cloud, Office etc.)
- SSD data server app
- PC based operating system (Windows®7)



CUFOSInterface

User-Friendly Interface


CUFOS, the PC-based control created by Doosan Machine Tools, is an integrated system solution using an intuitive 19 inch touch screen. The system provides a convenient operator interface, a high level of customization and many useful high technology apps.





CUFOS operation for enhanced productivity

The CUFOS operating system is based upon the integration of all aspects of the manufacturing process, including setting, machining and maintenance. It consolidates up-to-date software technology created by Doosan Machine Tools, to improve overall efficiency and productivity. Using the system's modular construction, each function can be easy integrated with external PC software systems and applications, such as CAM and Tool Data systems.

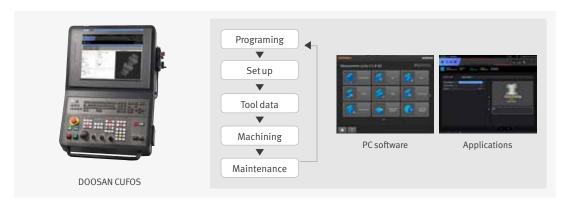



Maximizing efficiency for multi-tasking machining

Applied to those multi-tasking turning center like PUMA SMX series as well as high performance, high productivity horizontal machining center NHP/NHM series, CUFOS maximizes the operational efficiency by adding up-to-date software technology of Doosan Machine Tools including new developed application such as CPS (Collision Protection System), Turn-cut, and the Tool Management function etc.



Basic information

Basic Structure Main Units Machine Performance CUFOS

Detailed Information

Options
Diagrams
Specifications

Customer Support Service



Machining

Reduce downtime and improve productivity by providing CPS(Collision Protection System), real-time status monitoring and maintenance guides during operating the machine






CPS (Collision Protection System)

A function to prevent real-time collision in manual mode between the tool and equipment / machine elements inside the working area.

Applicable models : NHM/NHP/PUMA SMX series

• Supports Sandvik's cloud-based tool library for creation of 3D tool model

Use the Setup Manager with the CPS app to build up the machine model, and add tool, workpiece and workholding equipment

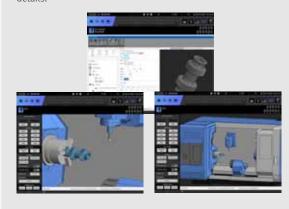



SSD data server

As a PC based NC, it allows the HDD to be used as a storage space for machining program, saving time for program transfer.

Applicable models: NHM/NHP/PUMA SMX series Max. storage size
40GB*

Max. file size

2GB

Max. file number

Up to 1000 (including folder)



* Max. storage size is determined by the size of SSD in Panel iHPro. If customer need Max. storage size of 40GB, it is necessary to select SSD129GB(option).



NC control

Easy to convert the screen to standard FANUC format for operator convenience





Status monitoring & Alarm guidance

Displays the cause and necessary action for NC/PMC alarms during machine running time. The system can send an email containing the alarm message if the condition persists for a specified time period.






Set up

Make easy & interactive guides to facilitate machining preparations such as setting materials, tool management and warming-up



Warming up

Automatically checks if a warm up process is required, and displays the required operator procedure graphically. The requirement is automatically determined by the machine status.

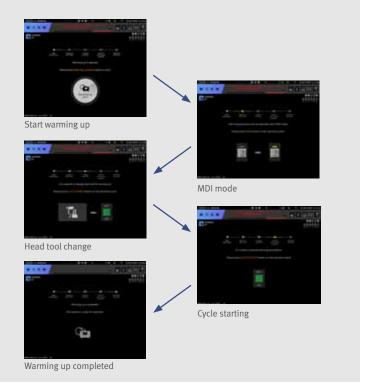

Applicable model: PUMA SMX series



Utility

Support user convenience functions and additional software modules handling various peripheral devices like measurement



Setting

CUFOS Provides management and setting functions such as HMI parameter / User setting / Setup manager /e-mail

User setting

Allows the user to register and delete up to six persons from the user account. CUFOS apps and NC functions can be user-restricted as necessary.





Memo

Users can generate memos, either with a high level of detail via screen capture, or entered by keyboard/touchscreen. The user can add data to existing memos if required

Maximum 120 memos can be saved







Screen capture

Memo through touch screen or key board or using a captured screen



Basic information

Basic Structure Main Units Machine Performance CUFOS

Detailed Information

Options

Diagrams
Specifications

Customer Support Service



Manual viewer

Users can store and view manuals on the 19 inch screen.





Maintenance manager

Monitors the status of machine and control elements, and confirms the alarm condition and maintenance schedule for preventative maintenance.






Video viewer

Video transfer and viewer functions make clearer communication possible between operators and helpful for training new workers, complex job arrangement

* Video format : .wmv, .avi, .mpg, .mpeg, .mp2, mp3, .wav, .mov, .mp4 (same as Window media open files)

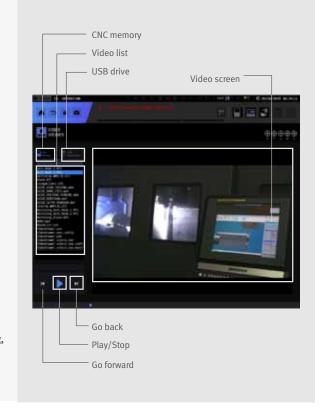



A diverse range of functions and apps are available to meet specific customer requirements.

NO.	Description	Features	PUMA SMX series	
1		19" Color LCD Screen		•
2		Main RAM memory (4GB)	•	
3			SSD 32GB (Max. storage size 10GB)	•
4	Hardware	Storage Memory	SSD 64GB (Max. storage size 20GB)	0
5			SSD 128GB (Max. storage size 40GB)	0
6		2point -touch panel port		•
7		Windows Embedded standard 7 Ope (Including the Recovery disk)	•	
8		0		
9		CPS (Collision Protection System)	0	
10		SSD Data server application	0	
11		Manager's Message Notification app	•	
12	Applications	FTP Server service	•	
13		Smart key access control application	0	
14		Memo application	•	
15		Machine status Monitor application		•
16		Alarm guidance application		•
17		Manual viwer application		•
18		Calendar application		•
19	iHMI Basic	Browser application		•
20	Application	Maintenance Manager application		•
21		Data Logger application		•
22			•	

^{*} Please contact your Doosan machine tool representative for detailed solution information.



Standard / Optional Specifications

● Standard ○ Optional X Not applicable

Basic information

Basic Structure Main Units Machine Performance CUFOS

Detailed Information

Options

Diagrams
Specifications

Customer Support Service

							• 3	lanuaru	O Optiona	at X NOL a	pplicable
NO.	Division	Option		PUMA SMX 2600	PUMA SMX 3100	PUMA SMX 3100L	PUMA SMX 2600S	PUMA SMX 3100S	PUMA SMX 3100LS	PUMA SMX 2600ST	PUMA SMX 3100ST
1	Tool shank	CAPTO C6		•	•	•	•	•	•	•	•
2		HSK-A63	an Assads a small	0	0	0	0	0	0	0	0
3	Automatic tool changer		on touch panel tion touch panel	0	0	0	0	0	0	0	0
5		40 tools		•	•	•	•	•	•	•	•
7	Tool magazine	80 tools		0	0	0	0	0	0	0	0*
	Long boring bar	120 tools		X	X	X	X	X	X		
8	magazine	3 tools		Х	X	0	Х	X	0	Х	X
9		Left	Hydraulic chuck 10" Hydraulic chuck 12"	0	X	X	0	X	X	0	X
11		spindle	Hydraulic chuck 15"	X	0	0	X	0	0	X	0
12		Right	Hydraulic chuck 10"	Х	Х	Х	•	•	•	•	•
13	Work	spindle	Hydraulic chuck 12"	X	X	X	0	0	0	0	0
15	holding	Dual pressur Chuck clamp	confirmation	0	0	0	0	0	0	0	0
16	device	Servo driven	steady rest(SLU3.1~SLU5)	0	0	0	0	0	0	X	X
			parking function is impossible			0			Ü	^	
17		parking func	steady rest(SLU5.1 or K5.0 or K5.1) with steady rest tion	X	X	0	X	X	0	X	X
18		Servo driven	steady rest(SLU3Z or3.1Z or 3.2Z) - for Lower turret	Х	Х	Х	Х	Х	Х	0	0
19		T-T-C	Pressure 1.0MPa (145 psi)/bag filter	•	•	•	•	•	•	•	•
20		(Through Tool	Pressure 3.0MPa (435 psi) / Cyclone filter Pressure 7.0MPa (1015 psi) / Cyclone filter	0	0	0	0	0	0	0	0
22		Coolant)	Pressure 7.0MPa (1015 psi)/paper filter	0	0	0	0	0	0	0	0
23		Milling	MQL (Minimum quantity lubrication) system	0	0	0	0	0	0	0	0
24	Coolant	spindle	Pressure 0.45MPa (65.2psi) / Tank screen fiter	X	X	X	X	X	X	•	•
25		For Lower turret	Pressure 0.7 / 1.0 / 1.45 MPa (101.5/145/151.1 psi) /	X	X	X	X	X	X	0	0
26		Oil skimmer	Tank screen fiter	0	0	0	0	0	0	0	0
27		Coolant pre	ssure switch	•	•	•	•	•	•	•	
			milling spindle / option for lower turret)								
28			el switch : Sensing level - Low or (Right disposal)	0	0	0	0	0	0	0	0
31		Chip bucket		0	0	0	0	0	0	0	0
32			or Left or Right spindle chuck)	•	•	•	•	•	•	•	•
33 34	Chip		ant (for Left or Right spindle chuck) Indle coolant (Left or Right)	0	0	0	0	0	0	0	0
35	disposal		lant(1.1kW, 165 liter/min)	0	0	0	0	0	0	0	0
36		Coolant gun		0	0	0	0	0	0	0	0
37 38		Air gun Mist collect		0	0	0	0	0	0	0	0
39		Thermal cor		•	•	•	•	•	•	•	•
40		Ball screw co	re cooling (X-axis)	•	•	•	•	•	•	•	•
41	High		re cooling (Y/Z-axis)	0	0	0	0	0	0	0	0
42	accuracy		er (temperature control) feed back (X1-axis)	0	0	0	0	0	0	0	0
44			feed back (X2-axis)	Χ	Х	Χ	Χ	Х	Х	0	0
45			feed back (Y/Z-axis)	0	0	0	0	0	0	0	0
46	Measurement	Auto tool set	ter ece measurement (RMP60)	0	0	0	0	0	0	0	0
48			er and conveyor	X	X	X	0	0	X	0	0
49	Automation	Workpiece ej		Х	X	X	0	0	X	0	0
50 51		Bar feeder in	nt door (with safety device)	0	0	0	0	0	0	0*	0*
52			monitoring system	•	•	•	•	•	•	•	•
53		Rotay type w		0	0	0	0	0	0	0	0
54	Others		nematic Compensation for Multi-tasking stomized by Doosan)	•	•	•	•	•	•	•	•
55		_	nematic Compensation for Multi-tasking (Datum Ball gage)	0	0	0	0	0	0	0	0
56		Quick change	e tooling(CAPTO) **	0	0	0	0	0	0	0	0
57	Standard Accessories	FOUNDATIO	N BOLT FOR ANCHORING	•	•	•	•	•	•	•	•
58			ADER AND CONVEYOR_GRIPPER TYPE	X	X	X	0	0	X	0	0
<u>59</u>			「_HOLDER_ON TURRET SHAFT WORKPIECE	X	X	X	X	X	X	0	0
61			NSING ON CHUCK_PREPARATION	0	0	0	0	0	0	0	0
62		DISPLAY UNI	T SIZE_19.0 INCH COLOR	0	0	0	0	0	0	0	0
63			R EXTENSION FOR SPECIAL CHUCK	X	X	X	X	X	X	0	0
64	Customized		PINDLE AIR CURTAIN SPINDLE AIR CURTAIN	O X	O X	O X	0	0	0	0	0
66	Special Option		P_NON-CONTACTING_NC4_RENISHAW	0	0	0	0	0	0	0	0
67			NON-CONTACTING_BLUM	0	0	0	0	0	0	0	0
68 69		MQL SYSTEN	R MILLING SPDL_MULTI PRESSURE	0	0	0	0	0	0	0	0
70			CK SYSTEM_MANUAL	0	0	0	0	0	0	0	0
71			WORK LIGHT FOR ATC MAGAZINE	0	0	0	0	0	0	0	0
72		ANGULAR HE	AD FOR MILLING SPINDLE_ATC	0	0	0	0	0	0	0	0

Servo driven Steady rest option 16, 17, 18

This equipment supports long workpieces during the machining process. Linear positioning of the steady rest is achieved by servo motor and ball screw and can be positioned during cycle.



Steady rest parking function*

When you don't want to use steady rest, you can make it parked under left chuck.

This function is possible just for PUMA SMX3100L/LS with the steady rest selected one from among SLU5.1, K5.0 and K5.1.

Applicable model	Steady rest	Working range
PUMA SMX2600 / S	SLU-3.1	Ø20~Ø165 mm (0.8~6.5 inch)
PUMA SMX2600 / S PUMA SMX3100/L/S/LS	SLU-3.2	Ø50~Ø200 mm (2.0~7.9 inch)
(Steady rest parking function is impossible)	SLU-4	Ø35~Ø245 mm (1.4~9.6 inch)
(Steady lest parking function is impossible)	SLU-5	Ø50~Ø310 mm (2.0~12.2 inch)
DUMA CMV24001 / LC	SLU-5.1	Ø85~Ø350 mm (3.3~13.8 inch)
PUMA SMX3100L / LS (Steady rest parking function is impossible)	K 5.0	Ø80~Ø390 mm (3.1~15.4 inch)
(Steady rest parking function is impossible)	K 5.1	Ø100~Ø410 mm (3.9~16.1 inch)
DUIMA CMAYO COOST / 24 OOST	SLU-3	Ø12~Ø152 mm (0.5~6.0 inch)
PUMA SMX2600ST / 3100ST	SLU-3.1	Ø20~Ø165 mm (0.8~6.5 inch)
- Steady rest for lower turret	SLU-3.2	Ø50~Ø200 mm (2.0~7.9 inch)

- In PUMA SMX2600/S, 3100/S, the steady rest parking function is not possible. And also, the function is not possible when the steady rest is selected from among SLU-3.1 to SLU-5 for PUMA SMX3100L/LS.
- Using 15-inch chuck in PUMA SMX3100L/LS instead of standard 12-inch, if you select Servo driven Steady rest for PUMA SMX3100L/LS, the steady rest must be K5.1 to make it use of steady rest parking function.


Chip Conveyor (Right side exit) Option 31

The conveyor provides a superior chip removal system and is designed with a stable structure for easy maintenance and reduced leakage. By selecting the correct type of conveyor, the efficiency of the machine working area is increased.

Name	Hinge Belt	Magnetic Scraper	Drum filter +Hinge scraper (Double type)
Application	For steel	For castings	For steel, castings, nonferrous metal
Features	- General - Appropriate for a heavy material chip of more than 30 mm in length	- Easy maintenance - Eject the chip by scraping and raising the chip with the scraper	- Appropriate for both a long and a short chip - Filtering coolant
Shape	Order Comment	Total Control	Togram of the state of the stat

Coolant Chiller (Recommendation) Option 43


A coolant chiller minimizes the thermal deformation by controlling the temperature of the return coolant to the machine, thus improving the accuracy.

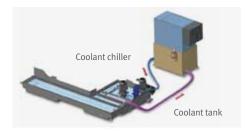

Optional Equipment for Automation

option 49, 50, 51

Various peripheral equipment is available to support the SMX to improve its performance and productivity.

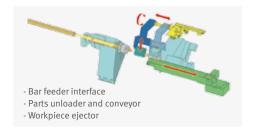

Tailstock application for lower turret option

- steady rest to support long and slim components for improving machining stability
- Tailstock application for lower turret is available to PUMA SMX2600ST/3100ST. Option



Tool Setter (Automatic) option 47

Auto linear motion type tool setter has been installed for tool measurement and tool wear detection. It is stored in a safe location during the machining process, and can be activated with the workpiece still in place in the chuck with no interference.



Gear skiving solutions

We propose a dramatic improvement in productivity with gear skiving solutions such as power skiving, invo-milling, and hobbing, which allow high-precision external / internal gear machining with a single setting.



* Please contact to DOOSAN on further information.

Linear scale option 44, 45, 46

We propose linear scale when you want to achieve high accuracy of simultaneous 5-axis machining, long term machining and higher feed precision.

Quick change CAPTO option 57

The Quick Change Tool system simplifies tool change operation. Recommended for users who need to change tools frequently or reduce the set-up time.



Lower turret Applicable

Basic information

Basic Structure Main Units Machine Performance CUFOS

Detailed Information


Options
Diagrams
Specifications

Customer Support Service

Spindle Power - Torque Diagram

PUMA SMX series

Both turning and milling spindles have powerful heavy-duty built-in type motors to maximize productivity.

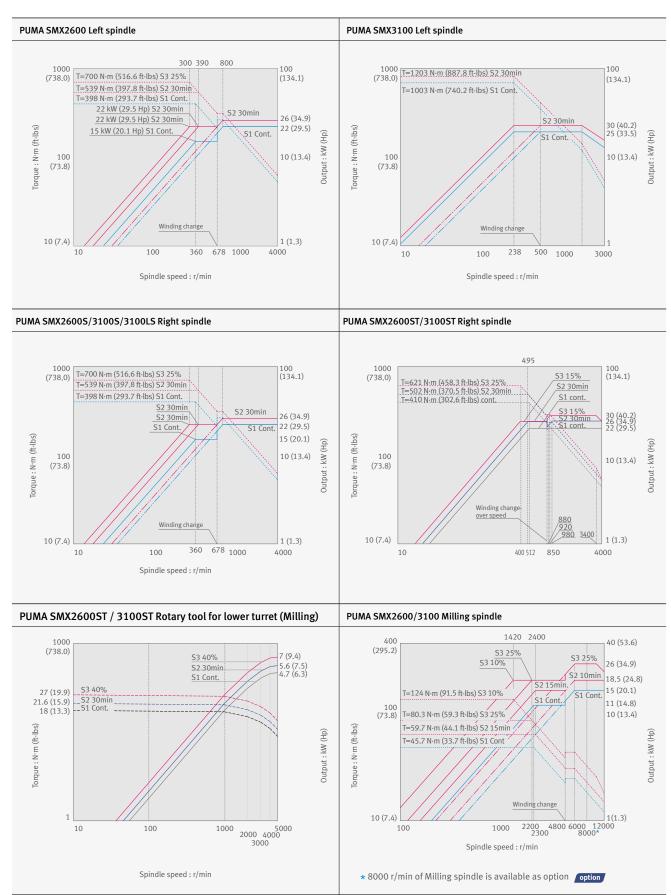


External Dimensions


PUMA SMX2600/S, 3100/L/S/LS (40/80 Tools)

Unit: mm (inch)

Top view

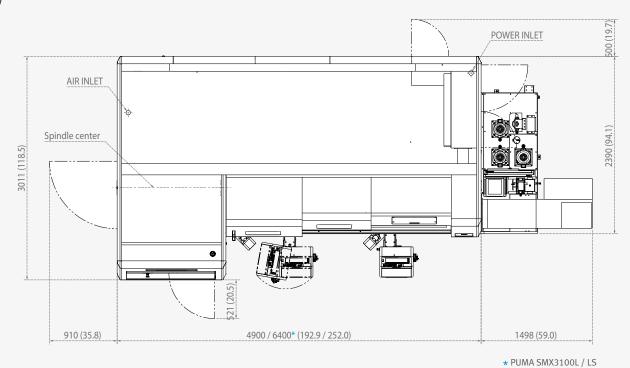

Front view

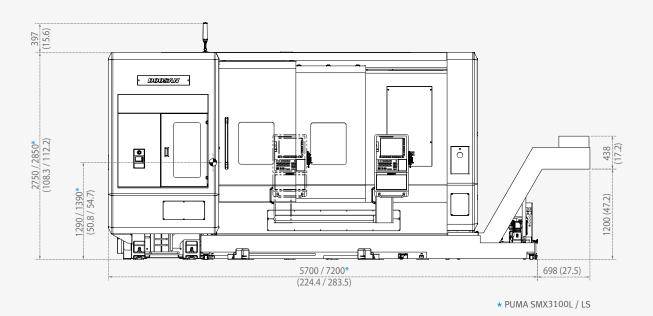

Machine foundation: Anchoring is recommended to maintain accuracy over a long period of time. The anchor bolts and other related parts for foundation work are supplied as standard items. Please consult with Doosan and sales technicians regarding ground and operating conditions.

Basic information

Basic Structure Main Units Machine Performance CUFOS

Detailed Information


Options
Diagrams
Specifications

Customer Support Service

External Dimensions

PUMA SMX2600ST/ 3100ST (40/80 Tools)

Unit: mm (inch)

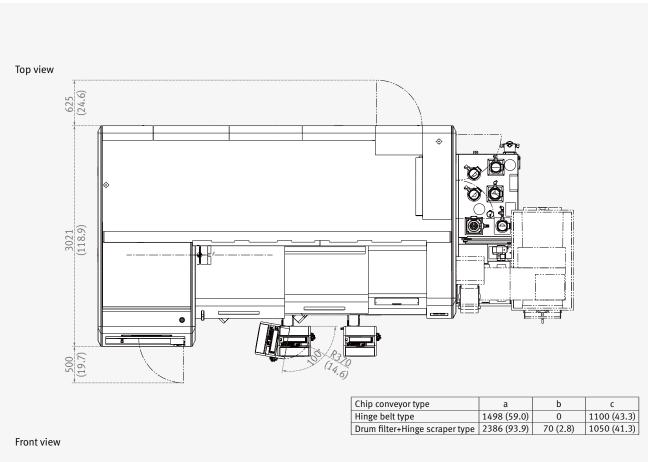

40 Tools: 4900 (192.9) / 80 Tools: 5035 (198.2) 397 (15.6) DOOSAN C=2820 (111.0)+b ಂ 360 (53.5)+b SMX2600: 1390 (54.7) CHIP BUCKET (SMX3100: 1370(53.9)) 40 Tools: 5790 (228.0) / 80 Tools: 5925 (233.3) 720 option (28.3)Length with side chip conveyor 1000 (39.4) (Maintenance space) 40 Tools: 4900 (192.9)+a / 80 Tools: 5035 (198.2)+a


Machine foundation: Anchoring is recommended to maintain accuracy over a long period of time. The anchor bolts and other related parts for foundation work are supplied as standard items. Please consult with Doosan and sales technicians regarding ground and operating conditions.

^{*}Some peripherals can be placed in different locations.

PUMA SMX2600ST/ 3100ST (120 Tools)

Unit: mm (inch)



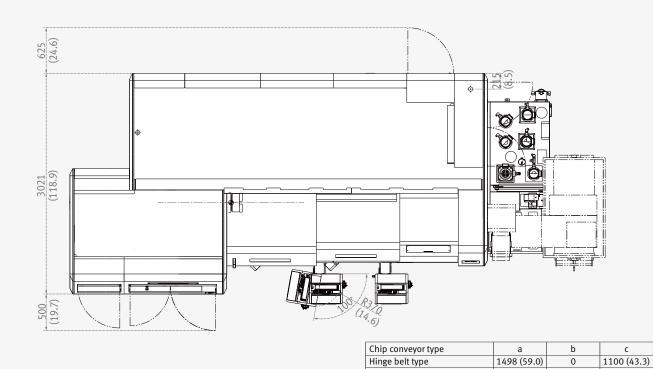


Drum filter+Hinge scraper type 2386 (93.9)

70 (2.8)

1050 (41.3)

Front view

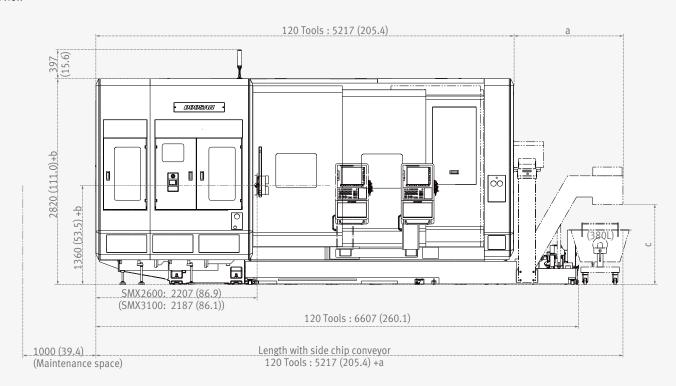

Machine foundation: Anchoring is recommended to maintain accuracy over a long period of time. The anchor bolts and other related parts for foundation work are supplied as standard items.

Please consult with Doosan and sales technicians regarding ground and operating conditions.

Basic information

Basic Structure Main Units Machine

Performance

CUFOS

Detailed Information


Options
Diagrams
Specifications

Customer Support Service

Working Range

PUMA SMX2600/SMX3100 series


Entire range Unit: mm (inch)

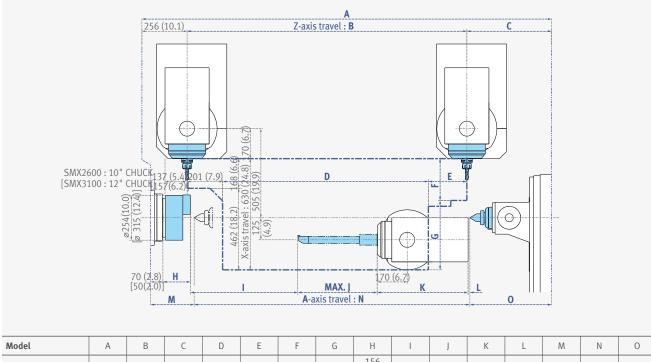


Model	А	В	С	D	Е	F	G	Н	I	J	K	L	M	N	0
PUMA SMX2600								156							
POWA SWAZOOO	2321	1585	480	1166	218	237	393	(6.1)	608	450	515	10	247	1562	463
PUMA SMX3100	(91.4)	(62.4)	(18.9)	(45.9)	(8.6)	(9.3)	(15.5)	176	(23.9)	(17.7)	(20.3)	(0.4)	(9.7)	(61.5)	(18.2)
PUMA SIMASTUU								(6.93)							
PUMA SMX3100L	3223	2585	382	2168	216	195	435	176	1610	450	515	12	313	2500	361
PUNIA SINIASTUUL	(126.9)	(101.8)	(15)	(85.4)	(8.5)	(7.7)	(17.1)	(6.93)	(63.4)*	(17.7)*	(20.3)	(0.5)	(12.3)	(98.4)	(14.2)

 $[\]mbox{\ensuremath{^{\star}}}\mbox{\ensuremath{^{\prime\prime}}}\mbox{\ensuremath{^{$


Y-axis working rage Unit: mm (inch) B-axis rotating range Unit: mm (inch)

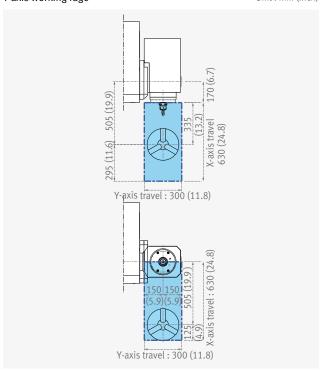

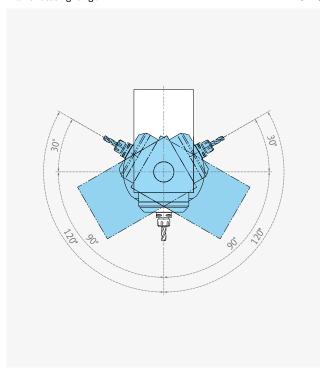

PUMA SMX2600S/SMX3100S series


Entire range Unit: mm (inch)

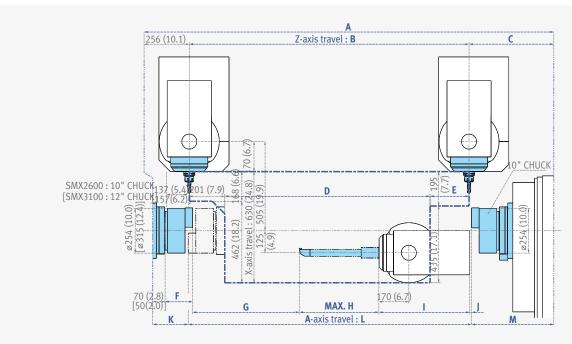


Model	А	В	С	D	E	F	G	Н	ı	J	К	L	М
PUMA SMX2600S	2321	1585	480	1163	221	156 (6.1)	605	450	515	10	201	1605	466
PUMA SMX3100S	(91.4)	(62.4)	(18.9)	(45.8)	(8.7)	176 (6.93)	(23.8)	(17.7)	(20.3)	(0.4)	(7.9)	(63.2)	(18.3)
PUMA SMX3100LS	3223 (126.9)	2585 (101.8)	382 (15)	2168 (85.4)	216 (8.5)	176 (6.93)	1610 (63.4)*	450 (17.7)*	515 (20.3)	10 (0.4)	311 (12.2)	2500 (98.4)	363 (14.3)

^{* &}quot;G" and "H" can be different depends on an applied long boring bar

Y-axis working rage Unit : mm (inch) B-axis rotating range Unit : mm (inch)

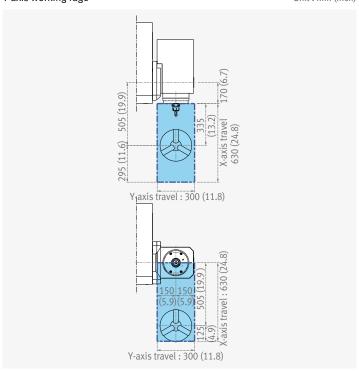

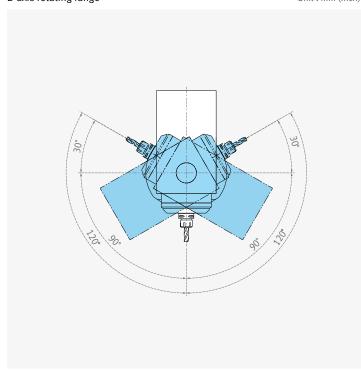

Working Range

Basic information

Basic Structure Main Units Machine Performance CUFOS


Detailed Information

Options
Diagrams
Specifications


Customer Support Service


PUMA SMX2600ST/SMX3100ST

Entire range Unit: mm (inch)

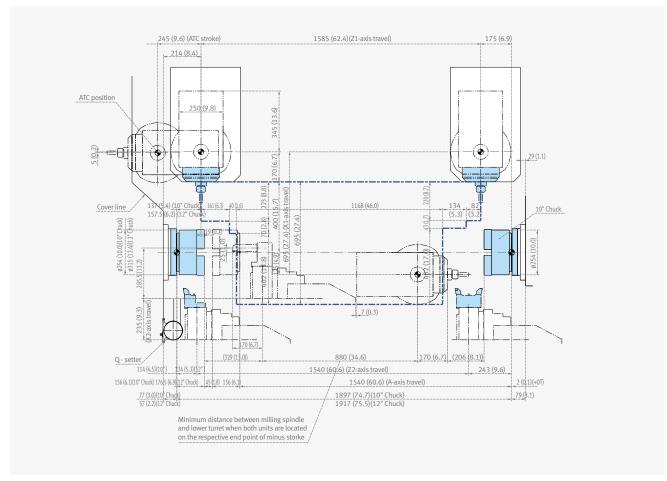

Y-axis working rage Unit: mm (inch) B-axis rotating range Unit: mm (inch)

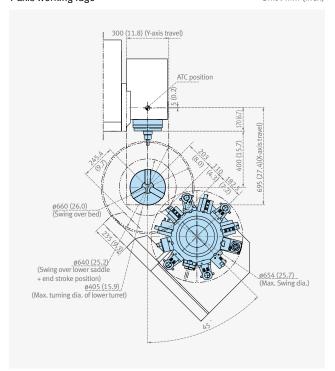


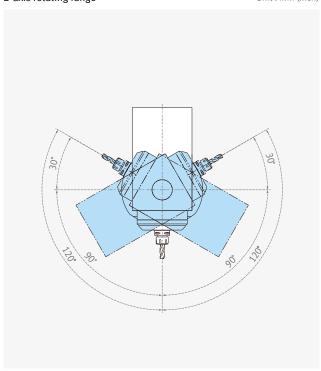


Unit: mm (inch)

Angular Milling Head


Straight Milling Head

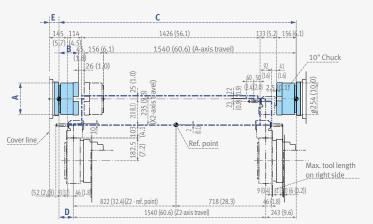

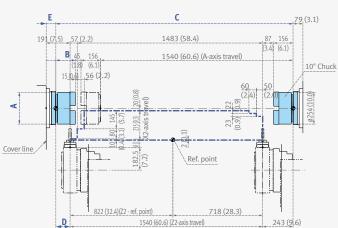

ID Tool Holder

OD Tool Holder

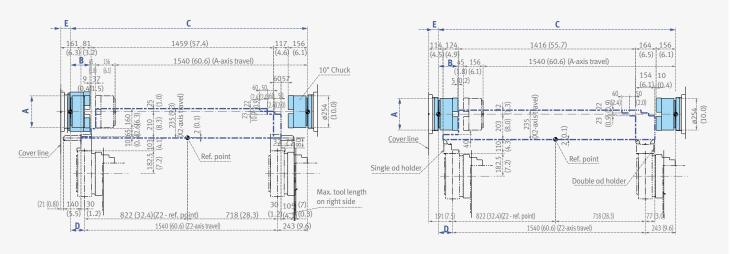

Model	Unit	А	В	С	D	E
PUMA SMX2600ST (10"Chuck)	mm (inch)	ø254 (10.0)	156 (6.1)	1897 (74.7)	114 (4.5)	77 (3.0)
PUMA SMX3100ST (12" Chuck)	mm (inch)	ø315 (12.4)	176.5 (6.9)	1917 (75.5)	134 (5.3)	57 (2.2)

Tool Interference Diagram of Lower Turret

Basic information


Basic Structure
Main Units
Machine
Performance
CUFOS

Detailed Information


Options
Diagrams
Specifications

Customer Support Service

For Turning (12 stations)

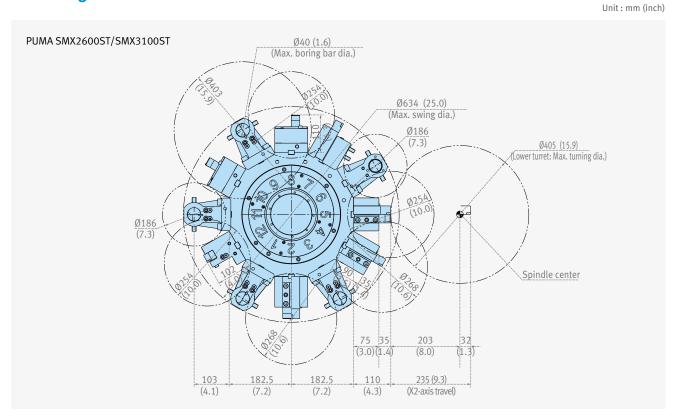


For Turn-Milling (12 stations, BMT65P)

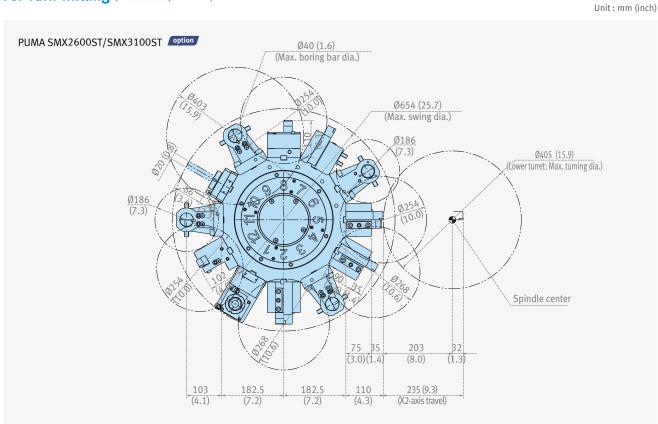

PUMA SMX series

PUMA SMX2600ST/SMX3100ST

Unit: mm (inch)

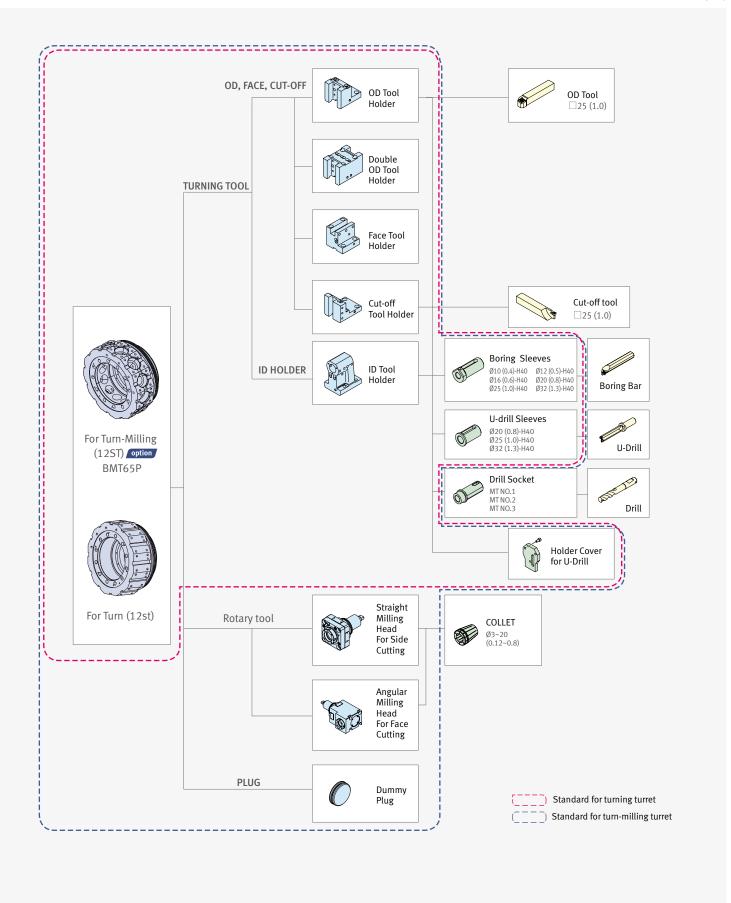

Basic information

Basic Structure Main Units Machine Performance CUFOS

Detailed Information

Options Diagrams Specifications

Customer Support Service

Machine Specifications



Standard Features

- Tool and tool box
- Through spindle coolant for milling spindle
- Door interlock
- Level bolt and plate
- Servo tail stock (for PUMA SMX2600/3100/3100L)
- Spindle head cooling system
- Hydraulic unit
- Automatic coolant system
- Work lamp
- Standard hydraulic chuck
- X-axis linear scale (only PUMA SMX3100L/LS)

PUMA SMX 2600 /3100	

	1	1	,		,	
Item			Unit	PUMA SMX2600	PUMA SMX2600S	
Capacity	Swing over bed		mm (inch)	660	(26.0)	
	Recom. turning diameter		mm (inch)	255	(10.0)	
	Max. turning diameter		mm (inch)	660 (26.0)		
	Max. turning length		mm (inch)	1540	(60.6)	
	Chuck size	Left spindle	inch	10	{12}*	
		Right spindle	inch	-	10 {12}*	
	Chuck work weight (include		kg (lb)		(573.2)	
	Shaft work weight (include	chuck)	kg (lb)	·	1146.4)	
Travala	Bar working diameter	X-axis	mm (inch)		(3.2)	
Travels		Y-axis	mm (inch) mm (inch)		(24.8) (11.8 (±5.9))	
		Z-axis	mm (inch)		(11.0 (±3.9)) 5 (62.4)	
	Travel distance	A-axis**	mm (inch)	1562 (61.5)	1605 (63.2)	
	Traver distance	B-axis	deg		(±120)	
		C1-axis / C2-axis	deg		/ 360	
		X2-axis / Z2-axis	mm (inch)	=	-	
		X-axis	m/min (ipm)	48 (1	889.8)	
		Y-axis	m/min (ipm)	36 (1	417.3)	
		Z-axis	m/min (ipm)	48 (1	889.8)	
	Rapid traverse rate	A-axis**	m/min (ipm)	-	30 (1181.1)	
		B-axis	r/min		40	
		C1-axis / C2-axis	r/min	200	/ 200	
		X2-axis / Z2-axis	m/min (ipm)	-	-	
Left	Max. spindle speed		r/min		000	
spindle	Spindle motor power (30m	in/cont.)	kW (Hp)		34.9/29.5)	
	Spindle nose	F ()	ASA		2-8	
	Spindle bearing diameter (Spindle through hole	Front)	mm (inch) mm (inch)		(5.1)	
	Min. spindle indexing angle	deg		(3.6)		
Right	Max. spindle speed	e (C1-axis)	r/min	-	4000	
spindle	Spindle motor power (30m	in/cont.)	kW (Hp)	-	26/22 (34.9/29.5)	
	Spindle nose	, contay	ASA	_	A2-8	
	Spindle bearing diameter (Front)	mm (inch)	-	130 (5.1)	
	Spindle through hole		mm (inch)	-	91 (3.6)	
	Min. spindle indexing angle	e (C2-axis)	deg	-	0.001	
Milling spindle	Max. spindle speed		r/min	12000	{8000}*	
	Milling spindle motor powe	er (2.5min/10min/Cont.)	kW (Hp)		34.9/24.8/20.1)	
	Min. spindle indexing angle	e (B-axis)	deg		0001	
Automatic Tool	Tool storage capa. (Max.)		ea		{80}*	
Changer	Tool shank		- ({HSK-A63}*	
	Max. tool diameter contino		mm (inch)		(3.5)	
	Max. tool diameter without Max. tool length	aujacent tools	mm (inch) mm (inch)		(5.1)	
	Max. tool weight		kg (lb)		(26.5)	
	Max. tool moment		N·m (ft-lbs)		(7.2)	
	T 1 1 (T T T)	Tool-to-tool	sec		1.8	
	Tool change time (T-T-T)	Chip-to-chip	sec	7	7.8	
Lower turret	No. of tool stations		ea		-	
	OD tool size		mm (inch)		-	
	Max. boring bar size		mm (inch)		-	
	Turret Indexing time (1 stat	ion swivel)	S		-	
	Max. rotary tool speed		r/min		-	
Long Boring Bar Magazine (option	Tool storage capacity (Max.	torage capacity (Max.) ea -		-		
for SMX 3100L/LS)	Max. tool size		mm (inch)		-	
	Max. tool weight		kg (lb)		-	
Tail Stock	Quill bore taper		MT	#5	-	
	Quill travel		mm (inch)	1562 (61.5)	-	
Coolant	Coolant pump motor powe		kW (Hp)		(3.0)	
Power source	Electric power supply (rate	d capacity)	kVA	64.61	89.91	
Machine Dimensions	Height		mm (inch)	2750 (108.3)	2750 (108.3)	
D.IIICII310113	Length		mm (inch)	4900 (192.9)	4900 (192.9)	
	Weight		mm (inch)	3011 (118.5)	3011 (118.5)	
Control	Weight		kg (lb)	15800 (34832.5)	16200 (35714.4) SIEMENS 840D***/ CUFOS}*	
CONTROL	NC system			I VIAOCATI (I VIAOCATI-2) 2	DILIVILIAS 040D/ COLOS}	

PUMA SMX2600ST	PUMA SMX3100	PUMA SMX3100L	PUMA SMX3100S	PUMA SMX3100ST	PUMA SMX3100LS
255 (10.0)		660 (2	26.0) 315 (12.4)		
			J13 (12.4)		
660 (26.0) [Lower turret : 405 (15.9)]		660 (26.0)		660 (26.0) [Lower turret : 405 (15.9)]	660 (26.0)
1540 (60.6)	1540 (60.6)	2540 (100.0)		0 (60.6)	2540 (100.0)
10 {12}* 10 {12}*		-	12 {15}*	10 {12}*	
	-	- 1	500 (4400 0)	10 {12}*	
260 (573.2)			500 (1102.3)		
520 (1146.4)			1000 (2204.6)		
81 (3.2)			102 (4.0)		
695 (27.4)		630 (24.8)		695 (27.4)	630 (24.8)
		300 (±150) (11.8 (±5.9))		
1585 ((62.4)	2585 (101.8)	1585	5 (62.4)	2585 (101.8)
1540 (60.6)	1562 (61.5)	2500 (98.4)	1605 (63.2)	1540 (60.6)	2500 (98.4)
1540 (00.0)	1302 (01.3)	240 (±		1540 (66.6)	2500 (50.4)
		-			
		360 /	360	T	T
235 / 1540 (9.3 / 60.6)	-	-	-	235 / 1540 (9.3 / 60.6)	-
		48 (18	89.8)		
		36 (14	17.3)		
48 (1889.8)	48 (1889.8)	30 (1181.1)	48 (1	.889.8)	30 (1181.1)
30 (1181.1)	-	-		30 (1181.1)	
50 (22021.1)		40	0	J (2101.1)	
2//2/(0//0//0//220)		200 /		2//2//0//2//	
24 / 36 (944.9 / 1417.3)	-	-	-	24 / 36 (944.9 / 1417.3)	-
4000			3000		
26/22 (34.9/29.5)			30/25 (40.2/33.5)		
A2-8			A2-11		
130 (5.1)			160 (6.3)		
91 (3.6)			115 (4.5)		
0.0001			0.0001		
			0.0001	1000	
4000	-	-		4000	
26/22 (34.9/29.5)	-	-		26/22 (34.9/29.5)	
A2-8	-	-		A2-8	
130 (5.1)	-	-		130 (5.1)	
91 (3.6)	-	-		91 (3.6)	
0.001	-	-		0.001	
1		12000 {	8000}*		
		26/18.5/15 (34			
12 (22 (122))		0.00	001	10 (00 (100))	10 (00)
40 {80/120}*		40 {80}*		40 {80/120}*	40 {80}*
		CAPTO C6 {I	HSK-A63}*		
		90 (3	3.5)		
		130 ((5.1)		
		450 (2	17.7)		
			17.7) (6.5)		
		12 (2	(6.5)		
		12 (2 9.8 (7.2)		
		12 (2 9.8 (1.i	7.2) 8		
10		12 (2 9.8 (1 1.1 7.2	7.2) 8		
12		12 (2 9.8 () 1.4 7.4	7.2) 8	12	-
25 (1.0)		12 (2 9.8 (1 1.1 7.2	7.2) 8	25 (1.0)	-
		12 (2 9.8 () 1.4 7.4	7.2) 8		
25 (1.0)		12 (2 9.8 (i 1.i 7.i	7.2) 8	25 (1.0)	-
25 (1.0) 40 (1.6) 0.2		12 (2 9.8 (i 1.i 7.i	7.2) 8	25 (1.0) 40 (1.6) 0.2	-
25 (1.0) 40 (1.6) 0.2 5000		12 (2 9.8 (i 9.8 (i - 1.4 - 1.	7.2) 8	25 (1.0) 40 (1.6)	-
25 (1.0) 40 (1.6) 0.2	·	12 (2 9.8 (i 1.4 7.4 - 1	7.2) 8	25 (1.0) 40 (1.6) 0.2	-
25 (1.0) 40 (1.6) 0.2 5000		12 (2 9.8 () 1.4 7.4	7.2) 8	25 (1.0) 40 (1.6) 0.2	- - - - - - - - - - - - - - - - - - -
25 (1.0) 40 (1.6) 0.2 5000	-	12 (2 9.8 () 1.4 7.4	7.2) 8	25 (1.0) 40 (1.6) 0.2	- - - - - - - - - - - - - - - - - - -
25 (1.0) 40 (1.6) 0.2 5000	-	12 (2 9.8 () 1.4 7.4	7.2) 8	25 (1.0) 40 (1.6) 0.2	- - - - - - - - - - - - - - - - - - -
25 (1.0) 40 (1.6) 0.2 5000	-	12 (2 9.8 () 1.4 7.4	7.2) 8	25 (1.0) 40 (1.6) 0.2 5000	- - - - - - - - - - - - - - - - - - -
25 (1.0) 40 (1.6) 0.2 5000 - -	- - #5	12 (2 9.8 () 1.4 7.4	7.2) 8	25 (1.0) 40 (1.6) 0.2 5000	- - - - - - - - - - - - - - - - - - -
25 (1.0) 40 (1.6) 0.2 5000 - - -	-	12 (2 9.8 () 1.4 7.4	7.2) 8 8 8	25 (1.0) 40 (1.6) 0.2 5000	- - - - - - - - - - - - - - - - - - -
25 (1.0) 40 (1.6) 0.2 5000 - - -	- - #5 1562 (61.5)	12 (2 9.8 () 1.4 7.4	7.2) 8 8 8	25 (1.0) 40 (1.6) 0.2 5000	- - - - - - - - - - - - - - - - - - -
25 (1.0) 40 (1.6) 0.2 5000 - - - - - - 99.93	- #5 1562 (61.5) 67.61	12 (2 9.8 () 1.4 7.4	3.0) 94.71	25 (1.0) 40 (1.6) 0.2 5000	- - - - - - - - - - - - - - - - - - -
25 (1.0) 40 (1.6) 0.2 5000 - - - - - - 99.93 2820 (111.0)	- #5 1562 (61.5) 67.61 2750 (108.3)	12 (2 9.8 () 1.4 7.4	3.0) 94.71 2850 (112.2)	25 (1.0) 40 (1.6) 0.2 5000 - - - 103.93 2820 (111.0)	- - - - - - - - - - - - - - - - - - -
25 (1.0) 40 (1.6) 0.2 5000 - - - - - - 99.93	- #5 1562 (61.5) 67.61	12 (2 9.8 () 1.4 7.4	3.0) 94.71	25 (1.0) 40 (1.6) 0.2 5000	- - - - - - - - - - - - - - - - - - -
25 (1.0) 40 (1.6) 0.2 5000 - - - - - - - 99.93 2820 (111.0)	- #5 1562 (61.5) 67.61 2750 (108.3)	12 (2 9.8 () 1.4 7.4	3.0) 94.71 2850 (112.2)	25 (1.0) 40 (1.6) 0.2 5000 - - - 103.93 2820 (111.0)	- - - - - - - - - - - - - - - - - - -
25 (1.0) 40 (1.6) 0.2 5000 - - - - - - - - - - 99.93 2820 (111.0) 4900 (192.9)	- #5 1562 (61.5) 67.61 2750 (108.3) 4900 (192.9)	12 (2 9.8 () 1.4 7.4	3.0) 94.71 2850 (112.2) 4900 (192.9)	25 (1.0) 40 (1.6) 0.2 5000 - - - - 103.93 2820 (111.0) 4900 (192.9)	- - - - - - - - - - - - - - - - - - -

NC Unit Specification

Basic information

Basic Structure Main Units Machine Performance CUFOS

Detailed Information

Options Diagrams Specifications

Customer Support Service

FANUC 31i/31i-5

No. No.						• St	tandard	O Option	al X Not a	applicable
	No.	Itam		Space	SMX 2600,	SMX 2600S,	SMX 2600ST,	SMX 2600,	SMX 2600S,	SMX 2600ST,
Controlled axes	NO.	item		Spec.	3100/L	•		3100/L	•	
Controlled asses										
Controlled authorized authorized (Controlled (Controlled authorized (Controlled (Cont	1		Controlled axes			C1, B, Y, A,	C1, Y, B, X2,		,C1, B, Y, A,	C1, Y, B, X2,
Auto-	2		Simultaneously controlled axes		4 axes	4 axes	4 axes	5 axes	5 axes	5 axes
Inch/metric convesion	3		Synchronous/Composite control	(C1 & C2 Synchro Control)	Х	•	•	Х	•	•
Dispected disturbance torque detection function	4	dXIS	Inch/metric conversion		•	•	•	•	•	•
Divide tection function Divide tection with memory card Divide of the card and recover Divi	5		Stored stroke check 1		•	•	•	•	•	•
Card	6				•	•	•	•	•	•
Digital Dock Single block Sing	7				•	•	•	•	•	•
Operation Handle interruption Handle i	8		Tool retract and recover		0	0	0	0	0	0
Handle interruption	9		Dry run		•	•	•	•	•	•
Incremental Feed	10	Operation	Single block		•	•	•	•	•	•
Manual handle retrace	11		Handle interruption		0	0	0	0	0	0
Active block cancel	12		Incremental feed	x1, x10, x100, x1000	•	•	•	•	•	•
Nano interpolation	13		Manual handle retrace		0	0	0	0	0	0
Linear interpolation	14		Active block cancel		0	0	0	0	0	0
17 18	15		Nano interpolation		•	•	•	•	•	•
18 Polar coordinate interpolation	16		Linear interpolation		•	•	•	•	•	•
19 20 21 22 21 22 22 23 24 25 26 27 26 27 27 27 28 27 28 29 29 29 20 20 20 20 20	17		Circular interpolation	G02	•	•	•	•	•	•
Helical interpolation	18		Polar coordinate interpolation		•	•	•	•	•	•
Thread cutting	19		Cylindrical interpolation		•	•	•	•	•	•
The polation Thread cutting Thread	20		Helical interpolation		•	•	•	•	•	•
Thread cutting retract	21				•	•	•	•	•	•
Thirding Thirding	22		Multi threading		•	•	•	•	•	•
Continuous threading Variable lead thread cutting Circular thread cutting Polygon machining with two spindles High-speed skip Input signal is 8 points. Palanced cutting Only for more than 2 path control Corrected function Balanced cutting Only for more than 2 path control Corrected function Coverride cancel Absolute/incremental programming Diameter/Radius programming Diameter/Radius programming Automatic coordinate system Workpiece coordinate system Program Workpiece coordinate system Addition of workpiece coordinate system Direct drawing dimension programming	23		Thread cutting retract		•	•	•	•	•	•
Circular thread cutting	24	idilololis	Continuous threading		•	•	•	•	•	•
Polygon machining with two spindles Polygon machining with two spindles High-speed skip Input signal is 8 points. O O O O O O O O O O O O O O O O O O O	25		Variable lead thread cutting		0	0	0	0	0	0
Spindles High-speed skip Input signal is 8 points. O O O O O O O O O O O O O O O O O O	26		Circular thread cutting		0	0	0	0	0	0
29 3rd/4th reference position return	27				•	•	•	•	•	•
Teturn Balanced cutting Donly for more than 2 X X X X X X X X X	28		High-speed skip	Input signal is 8 points.	0	0	0	0	0	0
Balanced cutting path control X	29				•	•	•	•	•	•
Absolute/incremental programming Same block	30		Balanced cutting		Х	Χ	X	Χ	X	X
programming same block Diameter/Radius programming X-axis Dynamic switching of diameter/ radius specification Automatic coordinate system setting Workpiece coordinate system Morkpiece coordinate system preset Addition of workpiece coordinate system Addition of workpiece coordinate system Addition of workpiece coordinate system Direct drawing dimension programming programming same block	31		Override cancel		•	•	•	•	•	•
Dynamic switching of diameter/ radius specification Automatic coordinate system setting Workpiece coordinate system Workpiece coordinate system Workpiece coordinate system Addition of workpiece coordinate system Addition of workpiece coordinate system Addition of workpiece coordinate system Direct drawing dimension programming	32				•	•	•	•	•	•
radius specification Automatic coordinate system setting Workpiece coordinate system Workpiece coordinate system Workpiece coordinate system Workpiece coordinate system OOOOO OOOO Addition of workpiece coordinate system preset Addition of workpiece coordinate system Addition of workpiece coordinate system Direct drawing dimension programming OOOOOO OOOOO OOOOOOOOO Automatic coordinate system OOOOOO OOOOO OOOOOOOOOO OOOOOOOOO	33		Diameter/Radius programming	X-axis	•	•	•	•	•	•
setting Workpiece coordinate system input Workpiece coordinate system preset Addition of workpiece coordinate system Addition of workpiece coordinate system Direct drawing dimension programming setting Workpiece coordinate system O O O O O O O O O O O O O O O O O O O	34				0	0	0	•	•	•
Program input Workpiece coordinate system preset	35				•	•	•	•	•	•
Input Workpiece coordinate system O O O O O O O O O O O O O O O O O O	36		Workpiece coordinate system	G52 - G59	•	•	•	•	•	•
coordinate system Addition of workpiece coordinate system 300 pairs Direct drawing dimension programming	37				0	0	0	0	0	0
coordinate system Direct drawing dimension programming Direct drawing dimension programming	38			48 pairs	0	0	0	0	0	0
programming	39		Addition of workpiece	300 pairs	0	0	0	0	0	0
41 G code system A • • • • •	40				•	•	•	•	•	•
	41		G code system	А	•	•	•	•	•	•

								phtioliat Vivi	
				PUMA	PUMA	PUMA	PUMA	PUMA	PUMA
No.	Item		Spec.	SMX 2600,		SMX 2600ST,			SMX 2600ST,
NO.	item		Spec.	3100/L	3100S/LS	3100ST	3100/L	3100S/LS	3100ST
					Fanu	c 31i		Fanuc	31i-5
42		G code system	B/C	•	•	•	•	•	•
43		Chamfering/Corner R		•	•	•	•	•	•
44		Custom macro		•	•	•	•	•	•
45		Addition of custom macro common variables	#100 - #199, #500 - #999	•	•	•	•	•	•
46		Interruption type custom macro		0	0	0	0	0	0
47		Canned cycle		•	•	•	•	•	•
48	Program	Automatic corner override		0	0	0	0	0	0
49	input	3-dimensional coordinate system conversion		•	•	•	•	•	•
50		Macro executor		•	•	•	•	•	•
51		Macro executor + C language executor		Х	Х	•	Х	Х	•
52		Coordinate system shift		•	•	•	•	•	•
53		Direct input of coordinate system shift		•	•	•	•	•	•
54		Real time custom macro		0	0	0	0	0	0
55		Pattern data input		0	0	0	0	0	0
56	Operation	Easy Operation package		•	•	•	•	•	•
	Guidance								
57	Function	EZ Guidei(Conversational Programming Solution)		•	•	•	•	•	•
_58		Constant surface speed control		•	•	•	•	•	•
_59	Auxiliary/	Spindle override	0 - 150%	•	•	•	•	•	•
_60	Spindle	Spindle orientation		•	•	•	•	•	•
61	speed	Spindle synchronous control		Х	•	•	Х	•	•
62	function	Rigid tap		•	•	•	•	•	•
63		Arbitrary speed threading		0	0	0	0	0	0
64		Tool offset pairs	400-pairs	•	•	•	•	•	•
65		Tool offset pairs	499-pairs	0	0	0	0	0	0
66		Tool offset pairs	999-pairs	0	0	0	0	0	0
67		Tool offset		•	•	•	•	•	•
68]	Tool center point control		Х	Х	Х	Х	Х	X
69	Tool function /	Smooth TCP		Х	Х	Х	•	•	•
70	Tool compensation	Y-axis offset		•	•	•	•	•	•
71	compensation	Tool radius/Tool nose radius compensation		•	•	•	•	•	•
72		Tool geometry/wear compensation		•	•	•	•	•	•
73]	Automatic tool offset	G36/G37	•	•	•	•	•	•
74]	Direct input of offset value measured B		•	•	•	•	•	•
75]	Tool life management		•	•	•	•	•	•
76	Accuracy	Backlash compensation for each rapid traverse and cut	ting feed	•	•	•	•	•	•
77	compensation	Stored pitch error compensation		•		•	•	•	•
	function	Stored pitch char compensation		-	-	_	-		
78	-		1280M(512KB)_1000 programs	•	•	•	•	•	•
79	-		2560M(1MB)_1000 programs	0	0	0	0	0	0
80			5120M(2MB)_1000 programs	0	0	0	0	0	0
81		Part program storage size & Number of registerable	10240M(4MB)_1000 programs	0	0	0	0	0	0
82		programs	20480M(8MB)_1000 programs	0	0	0	0	0	0
83	Editing		2560M(1MB)_2000 programs	0	0	0	0	0	0
84	operation		5120M(2MB)_4000 programs	0	0	0	0	0	0
85			10240M(4MB)_4000 programs	0	0	0	0	0	0
86			20480M(8MB)_4000 programs	0	0	0	0	0	0
87		Program protect		•	•	•	•	•	•
88		Password function		•	•	•	•	•	•
89		Playback		0	0	0	0	0	0
90		Memory card program edit & operation	Max 63 programs	•	•	•	•	•	•
91		data server		0	0	0	0	0	0
92	Data input /	External data input		•	•	•	•	•	•
93	output	Memory card input/output		•	•	•	•	•	•
94		USB memory input/output		•	•	•	•	•	•
95		Automatic data backup		•	•	•	•	•	•
96	Interface	Embedded Ethernet		•	•	•	•	•	•
97	function	Fast Ethernet		0	0	0	0	0	0
	Others	Display unit	15" color LCD	•	•	•	•	•	•
98		PMC ladder function	64000 steps	X	X	•	Х	X	•
98	DMC Systom	PINIC lauder function	0 1000 50005						
	PMC System	1st level execution cycle of ladder	4ms	•	•	•	•	•	•
99			· · · · · · · · · · · · · · · · · · ·			•	0		•

NC Unit Specification

Basic information

Basic Structure
Main Units
Machine
Performance
CUFOS

Detailed Information

Options
Diagrams
Specifications

Customer Support Service

SIEMENS S840D

● Standard ○ Optional X Not applicable

_			■ Standard C	Optional X Not applicable
				S840D (5 axes)
No.	Item		Spec.	PUMA SMX2600/3100 series (without Lower turret)
1			Normal type for Multi- tasking machine	X1, Z1, Y1, B1, C1, C3, W1, MG1, MG2, ARM,SH
2		Controlled axes	S-type for Multi-tasking machine	X1, Z1, Z3, Y1, B1, C1, C2, C3, W1, MG1, MG2, ARM,SH
3		Additional controlled axes	Max. 31 axes in total(S840Dsl) /Max. 8 axes in total(S828D)	0
4		Simultaneously controlled axes	Positioning(G00)/Linear interpolation(G01): 5 axes Circular interpolation(G02, G03): 2 axes	•
5		Backlash compensation		•
6		Leadscrew error compensation		•
7	Controlled axis	Measuring system error compensation		•
8	•	Feedforward control	velocity-dependent	•
9		Follow up mode		•
10		Programmable acceleration		•
11		Emergency stop / overtravel		•
12		Least command increment	0.001mm (0.0001 inch)	•
13		Least input increment	0.001mm (0.0001 inch)	•
14		Maximum commandable value	±99999.999mm (±3937 inch)	•
 15		Machine lock (PRT)		•
16		Position switching signals/cam controller		•
17		Absolute encoder		•
18		Travel to fixed stop with Force Control		•
19		Reference point return	G75 FP=1	•
20		2nd reference point return	G75 FP=2	•
21		3rd / 4th reference return	G75 FP=3, 4	•
22		Linear interpolation	Max. 4	•
23		Circular interpolation	G02, G03	•
24		Inverse time feedrate	G93	•
25		Helical interpolation		•
26		Universal interpolator NURBS		•
27	Interpolation &	Spline interpolation (A, B and C splines)		•
28	Feed functions	Dwell	G04	•
29		Separate path feed for corners and chamfers		•
30		Reposition		•
31		Acceleration with Jerklimitation		•
33		Compressor for 5-axis machining		•
34		Temperature compensation		•
35		peracure compensation	CP-Basic	•
36		Couplings	CP-Expert	•
			ст-схрет	

				SOLOD (5)
No.	Item		Spec.	S840D (5 axes)
				PUMA SMX2600/3100 series (without Lower turret)
37		Spindle override	50 - 120 %	•
38	Controlle Constitue	Automatic gear state selection		•
39	Spindle function	Oriented spindle stop		•
40		Retraction for rigid tapping		•
41		Tool radius compensations in plane		
42		3D Tool radius compensation	incloded in MDynamics 5-axis	0
43		Number of tools/cutting edges in tool list		600/1500
44	Tool function	Tool length compensation		•
45		Operation with tool management		•
46		Monitoring of tool life and workpiece count		•
47		Magazine list		•
48		Number of levels for skip blocks 1		•
49		Number of levels for skip blocks 8		0
50		Program functions		
51		Dynamic preprocessing memory FIFO		•
52	Programming &	Program editor		
53	Editing operation	Programming graphics/free contour input (contour calculator)		•
54		Screens for 1/2/3-point contours (contour definition programming)		•
55		Support for parameter input Animated Elements		•
56		ShopTurn/ShopMill Machining step programming		•
57		Technology cycles for drilling/milling		•
58		JOG		
59		Handwheel selection		•
60		Switchover: inch/metric		•
61		Manual measurement of zero/work offset		•
62		Manual measurement of tool offset		•
63		Automatic tool/workpiece measurement		•
64		Reference point approach, automatic/via CNC program		•
65		Automatic		
66		Execution from USB or CF card interface on operator panel front		•
67		Execution from HMI memory on NCU CF card		•
68		Execution from network drive		0
69		Execution from Hard disk (PCU50.5)		0
70		Preset		
71		19.0" color display		•
72		Operating software languages		
73	Others function	Alarms and messages		•
74	(Operation, setting &	Remote Control System (RCS) remote diagnostics		
75	Display, etc)	Measuring, Measuring stage 1		•
		Two probes (switching) with/without deletion of distance-to-go		
		Measuring stage 2 • Axial measurement		
76		Measurements from synchronized actions		0
		Cyclic measuring		
		Measuring cycles for drilling/milling and turning		
77		Calibrating workpiece probes		•
		Workpiece measurement Tool measuring		
70		Tool measuring Contain handwheel		
78		Contour handwheel		•
79 ——		Integrate screens in SINUMERIK Operate with SINUMERIK Integrate Run MyScreens		•
80		Cross-mode actions		•
		(ASUPs and synchronized actions in all operating modes)		
81		Collision avoidance (machine, working area)	It is valid in only 1CH	•
82		MDynamics 5-axis		•

NC Unit Specification

CUFOS

● Standard ○ Optional X Not applicable

Basic information

Basic Structure
Main Units
Machine
Performance
CUFOS

Detailed Information

Options
Diagrams
Specifications

Customer Support Service

No.	Item		Spec.	PUMA SMX 2600, 3100/L	PUMA SMX 2600S, 3100S/LS	PUMA SMX 2600ST, 3100ST	PUMA SMX 2600, 3100/L	PUMA SMX 2600S, 3100S/LS	PUMA SMX 2600ST, 3100ST
					Fanuc 31i			Fanuc	31i-5
1		Controlled axes		6 (X, Z, C, B, Y, A)	7 (X1, Z1, C1, B, Y, A, C2)	9 (X1 ,Z1, C1, Y, B, X2, Z2, C2, A)	6 (X, Z, C, B, Y, A)	7 (X1, Z1 ,C1, B, Y, A, C2)	9 (X1, Z1, C1, Y, B, X2, Z2, C2, A)
2		Simultaneously controlled axes		4 axes	4 axes	4 axes	5 axes	5 axes	5 axes
3	Controlled axis	Synchronous/Composite control		X	•	•	X	•	•
4	unis	Inch/metric conversion		•	•	•	•	•	•
5		Stored stroke check 1		•	•	•	•	•	•
6		Unexpected disturbance torque detection function		•	•	•	•	•	•
7		DNC operation with memory card		•	•	•	•	•	•
8		Tool retract and recover		0	0	0	0	0	0
9		Dry run		•	•	•	•	•	•
10	Operation	Single block		•	0	0	•	0	0
11 12		Handle interruption Incremental feed	x1,x10,x100	•	•	•	•	•	•
13		Manual handle retrace	X1,X10,X100	0	0	0	0	0	0
14		Active block cancel		0	0	0	0	0	0
15		Nano interpolation		•	•	•	•	•	•
16		Linear interpolation		•	•	•	•	•	•
17		Circular interpolation	G02	•	•	•	•	•	•
18 19		Polar coordinate interpolation Cylindrical interpolation		•	•	•	•	•	•
20		Helical interpolation		•	•	•	•	•	•
21		Thread cutting, synchronous					•	•	
		cutting		•		_			•
22	lutam alatian	Multi threading		•	•	•	•	•	•
23 24	Interpolation functions	Thread cutting retract Continuous threading		•	•	•	•	•	•
25		Variable lead thread cutting		0	0	0	0	0	0
26		Circular thread cutting		0	0	0	0	0	0
27		Polygon machining with two spindles		•	•	•	•	•	•
28		High-speed skip	Input signal is 8 points.	0	0	0	0	0	0
29		3rd/4th reference position return		•	•	•	•	•	•
30		Balanced cutting	Only for more than 2 path control	Х	Х	Х	Х	Х	Х
31	Feed function	Override cancel		•	•	•	•	•	•
32		Absolute/incremental programming	Combined use in the same block	•	•	•	•	•	•
33		Diameter/Radius programming	X-axis	•	•	•	•	•	•
34		Dynamic switching of diameter/radius specification		0	0	0	•	•	•
35		Automatic coordinate system setting		•	•	•	•	•	•
36		Workpiece coordinate system	G52 - G59	•	•	•	•	•	•
37		Workpiece coordinate system preset		0	0	0	0	0	0
38		Addition of workpiece coordinate system	48 pairs	0	0	0	0	0	0
39		Addition of workpiece coordinate system	300 pairs	0	0	0	0	0	0
40	Program input	Direct drawing dimension programming		•	•	•	•	•	•
41	mput	G code system	A	•	•	•	•	•	•
42		G code system	B/C	•	•	•	•	•	•
43		Chamfering/Corner R		•	•	•	•	•	•
44		Custom macro Addition of custom macro	#100 - #199, #500 -	•	•	•	•	•	•
45 — 46		common variables Interruption type custom macro	#999	0	•	0	•	0	0
47		Canned cycle		•	•	•	•	•	•
48		Automatic corner override		0	0	0	0	0	0
49		3-dimensional coordinate system conversion		•	•	•	•	•	•
		,							

No.							• 50	andura o c	peronat XII	от аррисавте
Mail Septe Septe					PUMA	PUMA	PUMA	PUMA	PUMA	PUMA
Macro record Section					SMX 2600,	SMX 2600S,	SMX 2600ST,	SMX 2600,	SMX 2600S,	SMX 2600ST,
Mano secution Mano secutio	No.	Item		Spec.	3100/L	3100S/LS	3100ST	3100/L	3100S/LS	3100ST
Mano secution Mano secutio						Fanu	r 31i		Fanuc	31i-5
Major sector < Cleanager executor	50		Macro executor		•			•	1	
Commitment experters whith										•
Direct Injury of conditionals system shift Section			, ,							•
Real time custom maco		input				-			-	•
Second Pattern dail import Second Second					0	0	0	0	0	0
Compared States, page control Compared States, page contro		Operation			0	0	0	0	0	0
Auxiliary Spindle Sp			·				_		_	
Springle control Springle S		Function	Еаѕу Орегаціон раскаде		•	•	•	•	•	•
Spindle Spin					•	•	•	•	•	•
Springer Springer				0 - 150%						•
Rigid top						-		-	-	•
Arbitrary speed threading						-			-	•
Tool of the pairs		function			-					
Tool offset pairs										0
Tool offset pairs Pool of set pairs Pool						-				X
Tool center point control										•
Total function Foundation				999-pairs						0
Section Compensation Compensat										•
Section Compensation Compensat		Tool function /								X
Compensation Comp					1					•
	69					-		-		•
Automatic tool offset									-	•
Direct input of offset value measured B	71		<u> </u>							
Tool life management					-					•
Couracy			·		-	-	-		-	•
Compensation Com	74				•	•	•	•	•	•
Total content	75				•	•	•	•	•	•
1280M(512KB) 1000 programs						_		-		
Part program storage size & 10240M(AMB) 1000 programs 0		function	Stored pitch error compensation						-	•
Part program storage size &						-			-	
Solid Soli										0
Part program storage size & Number of registerable programs Quade (MIMB) 2000 programs Quade (MIM								-	-	0
March of registerable programs			Part program storage size &	10240M(4MB)_1000 programs						0
Activiting Activity					0	0	0	0	0	0
STANDAMINED ADDITION CONTROLLED STORM CONTR		Editing	Trainber of registerable programs			0	0	0	0	0
10240M(MMB), 4000 programs								-		0
Program protect		operation		10240M(4MB)_4000 programs	0	0	0	0	0	0
Password function				20480M(8MB)_4000 programs	0	0	0	0	0	0
Playback Memory card program edit & operation Max 63 programs • • • • • • • • • • • • • • • • • •			<u> </u>		•	•	•	•	•	•
Memory card program edit & operation Max 63 programs • • • • • • • • • • • • • • • • • •					•	•	•	•	•	•
Data input Data input Data input Post Data input Data inpu								-		0
Data input Data input Data input Memory card input / Joutput USB memory USB memor				Max 63 programs	•	•	•	•	•	•
Data Imput/ output USB memory card input/output USB memory input/output USB memory input/output Automatic data backup					0	0	0	0	0	0
Output Welmory card in puty output	91	Data input /			-	•	•	•	•	•
USB memory input/output			· · · · ·		•	•	•	•	•	•
Interface Embedded Ethernet Fast Ethernet O O O O O O O O O O O O O O O O O O	93	Juiput	USB memory input/output		•	•	•	•	•	•
Fast Ethernet						•	•			•
Robot Robot Robot interface with PMC I/O module		-								•
Interface		function								0
Display Unit							0		0	0
Main RAM Memory		interface								0
Storage Memory SSD 32GB				,						•
Storage Memory			Main RAM Memory							•
103 104					-	-			+	•
Doosan Tool Management for SMX			Storage Memory							0
Collison Protection System				SSD 128GB						0
The size of RAM and SSD are automatically expanded to 8GB and 64GB, respectively.	104		Doosan Tool Management for SMX		0	0	0	0	0	0
Collison Protection System automatically expanded to 8GB and 64GB, respectively. SSD Data server Application 5GB 0				1						
106 107 108 109	105		Collison Protection System		0	0	0	0	0	0
106 107 108 109 100	200				~	~		~		
SSD Data server Application 20GB				, , ,						
108 109 Manager's Message Notification application						-				•
Manager's Message Notification application			SSD Data server Application							0
TFP Server service		CUFOS		40GB	-					0
111 Smart key access control application 0										•
112 Memo Application • • • • • • • • • • • • • • • • • • •					-					•
Machine status Monitor application Alarm guidance application Manual viewer Application Calendar Application Browser Application Maintenace Manager Application Data Logger Application Data Logger Application					-	-			+	0
114 Alarm guidance application • • • • • • • • • • • • • • • • • • •										•
115 Manual viewer Application • • • • • • • • • • • • • • • • • • •										•
116 Calendar Application • • • • • • • • • • • • • • • • • • •						•	•	•	•	•
117 Browser Application • • • • • • • • • • • • • • • • • • •			**		•	•	•	•	•	•
118 Maintenace Manager Application • • • • • • 119 Data Logger Application • • • • • • •	116				•	•	•	•	•	•
Data Logger Application	117				•	•	•	•	•	•
					•	•	•	•	•	•
	119		Data Logger Application		•	•	•	•	•	•
Jet volewei Application	120		Servo viewer Application		•	•	•	•	•	•

Basic information


Basic Structure Main Units Machine Performance CUFOS

Detailed Information

Options
Diagrams
Specifications

Customer Support Service


Responding to Customers Anytime, Anywhere

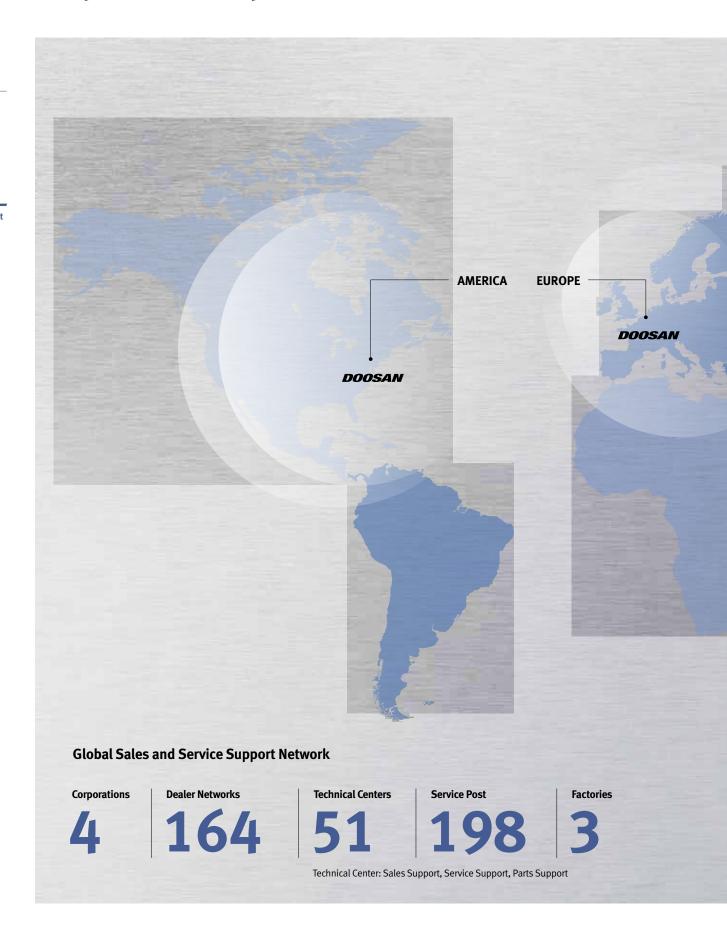

Doosan Machine Tools' Global Network, Responding to Customer's Needs nearby, Anytime, Anywhere

Doosan machine tools provides a system-based professional support service before and after the machine tool sale by responding quickly and efficiently to customers' demands.

By supplying spare parts, product training, field service and technical support, we can provide top class support to our customers around the world.

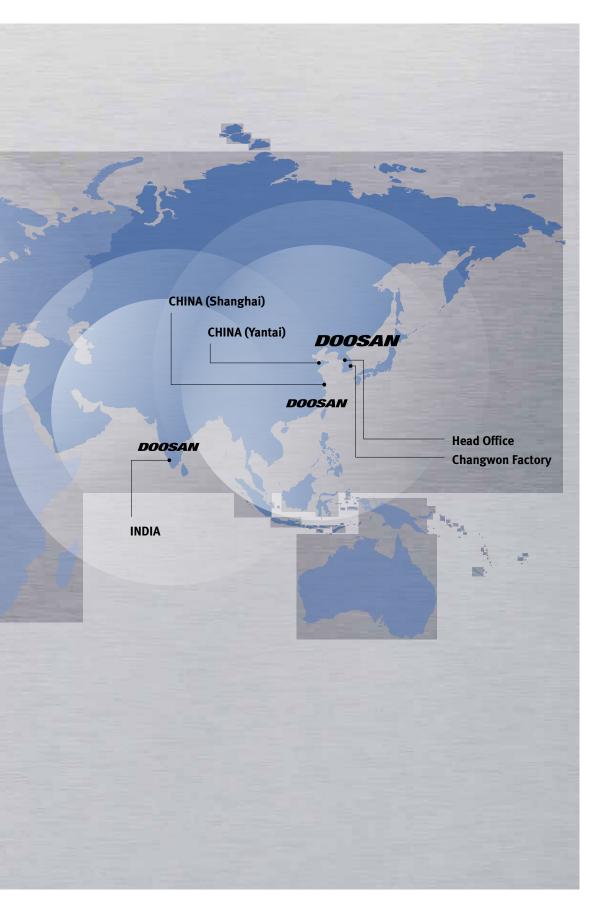

Customer Support Service

We help customers to achieve success by providing a variety of professional services from presales consultancy to post-sales support.

Supplying Parts



- Supplying a wide range of original Doosan spare parts
- Parts repair service

Field Services



- On site service
- Machine installation and testing
- Scheduled preventive maintenance
- Machine repair

Technical Support



- Supports machining methods and technology
- Responds to technical queries
- Provides technical consultancy

Training



- Programming / machine setup and operation
- Electrical and mechanical maintenance
- Applications engineering

PUMA SMX series



Description	Unit	PUMA SMX2600	PUMA SMX3100/L	PUMA SMX 2600S/ ST	PUMA SMX3100S/ LS/ST		
Chuck (Left spindle)	inch	10 {12}*	12 {15}*	10 {12}*	12 {15}*		
Chuck (Right spindle)	inch	- 10 {12}*					
Max. turning diameter	mm (inch)	660 (26.0)					
Max. turning length	mm (inch)			(60.6) S : 2540(100)]			
Spindle speed	Spindle speed r/min 40		3000	Left / Right : 4000	Left: 3000 Right: 4000		
Motor power	kW (Hp)	26/22 (34.9/29.5)	30/25 (40.2/33.5)	26/22 (34.9/29.5)	30/25 (40.2/33.5)		

*{ } Option

Doosan Machine Tools

www.doosanmachinetools.com



Head Office

22FT Tower, 30, Sowol-ro 2-gil, Jung-gu, Seoul, Korea, 04637

Tel +82-2-6972-0370 / 0350 Fax +82-2-6972-0400

Doosan Machine Tools America

19A Chapin Rd., Pine Brook, NJ 07058, U.S.A.

Tel +1-973-618-2500 Fax +1-973-618-2501

Doosan Machine Tools Europe

Emdener Strasse 24, D-41540 Dormagen, Germany

Tel +49-2133-5067-100 Fax +49-2133-5067-111

Doosan Machine Tools India

No.82, Jakkuar Village, Yelahanka Hobil, Bangalore-560064

Tel + 91-80-2205-6900 <u>E-mail india@doos</u>anmt.com

Doosan Machine Tools China

Room 101,201,301, Building 39 Xinzhuan Highway No.258 Songjiang District,China Shanghai(201612)

Tel +86 21-5445-1155 Fax +86 21-6405-1472

- * For more details, please contact Doosan Machine Tools.
- * The specifications and information above-mentioned may be changed without prior notice.
- * Doosan Machine Tools Co., Ltd. is a subsidiary of MBK Partners. The trademark **DOOSAN** is used under a licensing agreement with Doosan Corporation, the registered trademark holder.

